

VA Palo Alto Fire Sprinkler Deficiencies to be Corrected
Building 4
1st Floor
Concealer viking white, painted, also change to 401. Obstructed by light. Copy machine room C-146.
B-115, no sprinkler coverage (add a total of (2)).
2nd Floor
Small restroom C-239 cut/adjust drop with concealer head.
3rd Floor
Standard Sprinkler Pendant quick response 155° central obstructed by exhaust hood in corner. Relocate. C-301 Lab.
Standard Sprinkler Pendant quick response 155° central obstructed by exhaust hood in corner. Relocate. C-302 Lab.
Electrical room A-311 concealer A-310 obstructed by surface mounted light, Extend to 401. Difficult fix
Building 5
1st Floor
A total of (2) Standard Sprinkler Upright are obstructed by a duct. Relocate both or add. Located in dirty utility room next to "shop repairs".
2nd Floor
In electrical A-243, concealer head is below sheetrock ceiling. Cut/ adjust drop. Viking 165° Quick Response concealer.
Concealer head obstructed by emergency exit sign. End of hallway near C-287. Add or relocate. Rasco concealer.
Building 100
Building 100 Basment:
A total of (1) Standard Sprinkler chrome 155° quick response 1/2" globe painted in middle of room. Clean linen/storage FB-220. Painted over; replace.
Building 100 1st Floor:
Standard Sprinkler Pendant painted globe 1/2 chrome 155° quick response entry way to radiology, painted over; replace.
Painted Standard Sprinkler Pendant entry way to EI-120, painted over; replace.
A total of (2) painted Standard Sprinkler Pendants in soffit in front of agent cashiers windows. Painted over; replace.
3rd Floor Wing A
A3-155, one Standard Sprinkler Pendant painted just inside door. Painted over; replace.
A3-122, one Standard Sprinkler Pendant painted. Painted over; replace.
3rd Floor Wing B
Six Standard Sprinkler Pendants painted or plastered at elevator lobby in sheetrock areas near surgical services. Painted over; replace.

3rd Floor Wing C
One painted Standard Sprinkler Pendant in clean utility C3-122. Painted over; replace.
3rd Floor Wing F
Three painted Standard Sprinkler Pendants in hallway next to F3-106. Painted over; replace.
Medical surgical ICU Standard Spinkler Pendants overspaced between rooms 8 & 9. 16-0 apart. Add or relocate.
4th Floor Wing B
Lobby of B4-100 Neurology service; Standard Sprinkler Pendants overpaced (16') same globe type. Relocate one head.
4th Floor Wing D
Men's & Women's restroom (D4-101 & D4-100), Standard Sprinkler Pendants obstructed by stall panel. Add or relocate same globe head.
4th Floor Wing E
Tissue culture room E4-226, add or relocate Standard Sprinkler Pendant. Unprotected pocket; (continued) sheetrock ceiling little access.
Building 102
Womens restroom 134, a total of (1) Standard Sprinkler Pendant central chrome 155° quick response chrome trim spray, obstructed by stall partition. Add or relocate.
Equipment room 111 Standard Sprinkler Pendant central about 12' off wall. Add or relocate.
MR Control room 1, Standard Sprinkler Upright in pendant position. Replace, cut/adjust drop. Sensitive area.
MB1
Electric room 109, there are two different temperature heads. Change 155° to Standard Sprinkler Pendant 200°.
MB2
Replace 1/4" bottom gauge.