



Comprehensive Damper Report

VA Caribbean Health System

Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203



888-675-4519

www.LifeSafetyServices.com

Contracted By: VA Caribbean Health System

Facility: VA Caribbean Health System

Last Inspection Date: December 15, 2014

Last Inspected By: Marquis O'Neal

FIRE & SMOKE DAMPER INSPECTION SERVICES

TESTING FREQUENCY: 6 YEARS FOR HEALTHCARE OCCUPANCY

EC.02.03.05 - EP 18 - FIRE AND SMOKE DAMPERS

NFPA 80, NFPA 105 and NFPA 101

CLIENT:

VA Caribbean Health System
10 Casia St
San Juan, KY 40218
United States

LAST INSPECTION DATE:

December 15, 2014

LAST INSPECTED BY:

Marquis O'Neal
LSS LIFE SAFETY SERVICES®
SUPPORT@LIFESAFETYSERVICES.COM
CORPORATE: 1-888-675-4519

LSS Life Safety Services®

Representative Signature: _____



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

Contracted By: VA Caribbean Health System

Building: Main Hospital · VA Caribbean Health System

Inspection Date: May 29, 2013–June 14, 2013 / Re-Inspection December 15, 2014

Inspected By: Dan Kovacs

Building Summary

Floor	Combination	Fire	Smoke	Pass	Fail	Non-Accessible	Total Dampers
Basement	14	3	5	16	3	3	22
Sub Basement	5	0	0	2	1	2	5
1st	3	5	14	9	6	7	22
2nd	1	32	5	9	14	15	38
3rd	0	6	1	3	0	4	7
4th	0	5	1	2	2	2	6
5th	0	6	3	3	2	4	9
6th	0	4	1	3	0	2	5
7th	0	7	5	5	0	7	12
8th	0	2	2	1	0	3	4
9th	0	2	0	1	0	1	2
GRAND TOTAL	23	72	37	42	39	51	132

SB to 2nd Floor:

Total = 87 Dampers

Pass = 36 Dampers

Fail = 24 Dampers

Non-Acc = 27 Dampers



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

Contracted By: VA Caribbean Health System

Facility: VA Caribbean Health System

Last Inspection Date: December 15, 2014

Last Inspected By: Marquis O'Neal

BASEMENT, AREA "A"

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	BA-FD-004	Inside mail room in post office	Fire	Inspection	NON-ACCESSIBLE	Existing drywall hatch too small	NON-ACCESSIBLE
05/29/13	BA-EFSD-010	Inside bio medics	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-024	In hallway outside of mail room	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-025	In hallway outside of mail room	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-031	In hallway above double doors to sterile storage	Combination	Inspection	FAIL	Actuator missing	FAIL
05/29/13	BA-EFSD-032	In hallway above double doors to sterile storage	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-035	Above double doors inside elevator lobby	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-046	In loading dock	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-047	In loading dock	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-048	In loading dock	Combination	Inspection	FAIL	Damper rusted in place, Inoperable Actuator	PASS
12/14/14	BA-EFSD-048	In loading dock	Combination	Repair	PASS		PASS
05/29/13	BA-EFSD-049	In loading dock	Combination	Inspection	FAIL	Damper rusted in place, Inoperable Actuator	PASS
12/14/14	BA-EFSD-049	In loading dock	Combination	Repair	PASS		PASS



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	BA-EFSD-050	In loading dock	Combination	Inspection	FAIL	Damper rusted in place, Inoperable Actuator	PASS
12/14/14	BA-EFSD-050	In loading dock	Combination	Repair	PASS		PASS
05/29/13	BA-EFSD-051	In loading dock	Combination	Inspection	FAIL	Damper rusted in place, Inoperable Actuator	PASS
12/14/14	BA-EFSD-051	In loading dock	Combination	Repair	PASS		PASS
05/29/13	BA-EFSD-054	Inside storage room across from nuclear med.	Combination	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	PASS
12/12/14	BA-EFSD-054	Inside storage room across from nuclear med.	Combination	Inspection	PASS		PASS
05/29/13	BA-EFSD-055	Inside storage room across from nuclear med.	Combination	Inspection	PASS		PASS
BASEMENT, AREA "C"							
05/29/13	BC-FD-071	Inside trash chute	Fire	Inspection	PASS		PASS
BASEMENT, AREA "D"							
05/29/13	BD-FD-019	Inside storage unit #D6	Fire	Inspection	PASS		PASS
05/29/13	BD-ESD-028	Inside ingredient control room #D33	Smoke	Inspection	FAIL	No Power Wired to Actuator	FAIL
05/29/13	BD-ESD-053	Above cash register inside retail store	Smoke	Inspection	FAIL	Inoperable Actuator, No Power Wired to Actuator	FAIL
05/29/13	BD-ESD-064	Above double doors to cafeteria	Smoke	Inspection	PASS		PASS
05/29/13	BD-ESD-073	Left of cash register inside retail store	Smoke	Inspection	NON-ACCESSIBLE	Existing drywall hatch too small	NON-ACCESSIBLE
12/15/14	BD-ESD-073	Left of cash register inside retail store	Smoke	Inspection	NON-ACCESSIBLE	Hard Ceiling	NON-ACCESSIBLE

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	BD-ESD-074	Left of cash register inside retail store	Smoke	Inspection	NON-ACCESSIBLE	Existing drywall hatch too small	NON-ACCESSIBLE
12/15/14	BD-ESD-074	Left of cash register inside retail store	Smoke	Inspection	NON-ACCESSIBLE	Hard Ceiling	NON-ACCESSIBLE
SUB-BASEMENT							
05/29/13	SBA-EFSD-047	In north side of sub basement	Combination	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	SBA-EFSD-048	In north side of sub basement	Combination	Inspection	PASS		PASS
05/29/13	SBA-EFSD-049	In north side of sub basement	Combination	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	SBA-EFSD-050	In north side of sub basement	Combination	Inspection	PASS		PASS
05/29/13	SBA-EFSD-060	Inside sub basement center location	Combination	Inspection	FAIL	Inoperable Actuator, Access door rusted shut, Access door installation not authorized	FAIL
1st FL, AREA "A"							
05/29/13	1A-ESD-131	Inside stairwell #1	Smoke	Inspection	PASS		PASS
05/29/13	1A-ESD-163	Above double doors to room #A101	Smoke	Inspection	FAIL	Inoperable Actuator, No Power Wired to Actuator	NON-ACCESSIBLE
12/12/14	1A-ESD-163	Above double doors to room #A101	Smoke	Inspection	NON-ACCESSIBLE	Pipes blocking	NON-ACCESSIBLE
1st FL, AREA "B"							
05/29/13	1B-FD-118	In hallway near room #B115	Fire	Inspection	PASS		PASS
05/29/13	1B-EFSD-255	Outside of room #B147	Combination	Inspection	FAIL	Inoperable Actuator, No Power Wired to Actuator	FAIL
05/29/13	1B-EFSD-256	Outside of room #B147C	Combination	Inspection	FAIL	No Power Wired to Actuator, No access door	FAIL
12/11/14	1B-EFSD-256	Outside of room #B147C	Combination	Inspection	FAIL	No Air to Actuator	FAIL

1st FL. AREA "C"

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	1B-ESD-111	In hallway near room #B158	Smoke	Inspection	PASS		PASS
05/29/13	1B-PSD-117	In hallway near room #B115	Smoke	Inspection	FAIL	No Air to Actuator, Not Enough Air to Actuator	FAIL
12/11/14	1B-PSD-117	In hallway near room #B115	Smoke	Inspection	FAIL	No Air to Actuator	FAIL
05/29/13	1C-FD-157	Outside of room #C168	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	1C-FD-164	In hallway across from room #130	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	1C-ESD-101	In hallway between rooms #C137 and #C139	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/11/14	1C-ESD-101	In hallway between rooms #C137 and #C139	Smoke	Repair	PASS		PASS
05/29/13	1C-ESD-103	Inside room #C139	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/11/14	1C-ESD-103	Inside room #C139	Smoke	Repair	PASS		PASS
05/29/13	1C-ESD-104	In hallway between rooms #C137 and #C139	Smoke	Inspection	PASS		PASS
05/29/13	1C-ESD-106	In hallway between rooms #C137 and #C139	Smoke	Inspection	PASS		PASS
05/29/13	1C-ESD-120	In hallway inside day hospital	Smoke	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	1C-ESD-153	Inside day hospital	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/11/14	1C-ESD-153	Inside day hospital	Smoke	Repair	PASS		PASS
05/29/13	1C-ESD-156	Inside day hospital	Smoke	Inspection	FAIL	Inoperable Actuator	PASS

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
12/11/14	1C-ESD-156	Inside day hospital	Smoke	Repair	PASS		PASS
1st FL. AREA "D"							
05/29/13	1D-FD-162	Inside stairwell near service elevator and room #D110	Fire	Inspection	NON-ACCESSIBLE	Existing drywall hatch too small	NON-ACCESSIBLE
05/29/13	1D-FD-165	Outside of room #D119	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	1D-EFSD-115	In hallway	Combination	Inspection	FAIL	Inoperable Actuator	FAIL
05/29/13	1D-ESD-125	Inside escort room #D111	Smoke	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	1D-ESD-144	Above double doors near room #D1110A	Smoke	Inspection	FAIL	Inoperable Actuator	FAIL
05/29/13	1D-ESD-161	Inside room #D124	Smoke	Inspection	FAIL	Actuator missing	FAIL
2nd FL. AREA "A"							
05/29/13	2A-FD-235	Above double doors to room #A209	Fire	Inspection	FAIL		FAIL
05/29/13	2A-FD-236	Inside mechanical room #A	Fire	Inspection	FAIL		FAIL
05/29/13	2A-FD-237	Inside mechanical room #A	Fire	Inspection	PASS		PASS
05/29/13	2A-FD-238	Inside mechanical room #A	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2A-FD-239	Inside mechanical room #A	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2A-FD-244	Above double doors to ward #2D2	Fire	Inspection	FAIL		FAIL
05/29/13	2A-FD-245	Above double doors to ward #2D2	Fire	Inspection	FAIL		FAIL
05/29/13	2A-FD-246	Inside mechanical room #266	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	2A-FD-247	Inside mechanical room #266	Fire	Inspection	PASS		PASS
05/29/13	2A-FD-248	Inside mechanical room #266	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2A-PSD-249	Inside mechanical room #266	Smoke	Inspection	FAIL	No Air to Actuator	FAIL
12/10/14	2A-PSD-249	Inside mechanical room #266	Smoke	Inspection	FAIL	No Air to Actuator	FAIL
2nd FL, AREA "B"							
05/29/13	2B-FD-201	Outside of mechanical room #B255A	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
12/10/14	2B-FD-201	Outside of mechanical room #B255A	Fire	Inspection	NON-ACCESSIBLE	No access door, metal too thick - no power close - needs large round	NON-ACCESSIBLE
05/29/13	2B-FD-203	Outside of mechanical room #B255A	Fire	Inspection	FAIL		FAIL
05/29/13	2B-FD-205	Above double doors near room #B205	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2B-FD-206	Above double doors near room #B205	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2B-ESD-254	Outside of mechanical room #B255A	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/10/14	2B-ESD-254	Outside of mechanical room #B255A	Smoke	Repair	PASS		PASS
2nd FL, AREA "C"							
05/29/13	2C-FD-207	Above double doors to mental health room #C214	Fire	Inspection	PASS		PASS
05/29/13	2C-FD-208	Above double doors to mental health room #C214	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	2C-FD-209	Above double doors	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2C-FD-210	Above double doors	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2C-FD-211	Above double doors near room #C220	Fire	Inspection	FAIL		FAIL
05/29/13	2C-FD-212	Above double doors near room #C220	Fire	Inspection	FAIL		FAIL
05/29/13	2C-FD-214	Inside mechanical room #C216	Fire	Inspection	FAIL	Damper rusted in place	FAIL
05/29/13	2C-FD-215	Inside mechanical room #C216	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2C-FD-216	Inside mechanical room #C216	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2C-FD-221	Inside mechanical room near men's restroom	Fire	Inspection	PASS		PASS
05/29/13	2C-FD-222	Inside men's restroom #C202	Fire	Inspection	NON-ACCESSIBLE	Existing drywall hatch too small	NON-ACCESSIBLE
05/29/13	2C-FD-223	Inside mechanical room near men's restroom	Fire	Inspection	PASS		PASS
05/29/13	2C-FD-224	Inside rec. room near metal kitchen window	Fire	Inspection	FAIL	Bound in tracks (racking)	FAIL
05/29/13	2C-FD-226	Inside room #C203E	Fire	Inspection	PASS		PASS
05/29/13	2C-FD-231	Across from room #C275	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE
05/29/13	2C-FD-252	Above double doors to mental health room #C214	Fire	Inspection	NON-ACCESSIBLE	Longer than arm's reach, No access door	NON-ACCESSIBLE

Date	Damper Number	Damper Location	Damper Type	Job Type	Result	Issues	Current Status
05/29/13	2C-ESD-218	In hallway near double doors and pharmacy	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/10/14	2C-ESD-218	In hallway near double doors and pharmacy	Smoke	Repair	PASS		PASS
05/29/13	2C-ESD-219	In hallway near double doors and pharmacy	Smoke	Inspection	FAIL	Inoperable Actuator	PASS
12/10/14	2C-ESD-219	In hallway near double doors and pharmacy	Smoke	Repair	PASS		PASS
05/29/13	2C-PFSD-213	Inside mechanical room #C216	Combination	Inspection	FAIL	Inoperable Actuator	FAIL
12/16/14	2C-PFSD-213	Inside mechanical room #C216	Combination	Repair	FAIL		FAIL
05/29/13	2D-FD-242	Above double doors to room #D265	Fire	Inspection	FAIL		FAIL
05/29/13	2D-FD-243	Above double doors to room #D265	Fire	Inspection	NON-ACCESSIBLE		FAIL
12/10/14	2D-FD-243	Above double doors to room #D265	Fire	Inspection	FAIL	Damper rusted in place	FAIL
05/29/13	2D-ESD-250	In hallway near room #D212	Smoke	Inspection	FAIL	Inoperable Actuator	FAIL

2nd FL, AREA "D"



COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mail room in post office

Tag: BA-FD-004

Type: Fire

Floor: Basement

Status: Non-Accessible

Reason:

- Existing drywall hatch too small, needs bigger drywall hatch to access damper



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside bio medics

Tag: BA-EFSD-010

Type: Combination

Floor: Basement

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway outside of mail room

Tag: BA-EFSD-024

Type: Combination

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway outside of mail room

Tag: BA-EFSD-025

Type: Combination

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

In hallway above double doors
to sterile storage

Tag: BA-EFSD-031

Type: Combination

Floor: Basement

Status: Fail

Reason:

- Actuator missing



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway above double doors
to sterile storage

Tag: BA-EFSD-032

Type: Combination

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors inside
elevator lobby

Tag: BA-EFSD-035

Type: Combination

Floor: Basement

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

In loading dock

Tag: BA-EFSD-046

Type: Combination

Floor: Basement

Status: Pass



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In loading dock

Tag: BA-EFSD-047

Type: Combination

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In loading dock

Tag: BA-EFSD-048

Type: Combination

Floor: Basement

Status: Fail

Reason:

- Damper rusted in place
- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In loading dock

Tag: BA-EFSD-048

Type: Combination

Floor: Basement

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In loading dock

Tag: BA-EFSD-049

Type: Combination

Floor: Basement

Status: Fail

Reason:

- Damper rusted in place
- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In loading dock

Tag: BA-EFSD-049

Type: Combination

Floor: Basement

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In loading dock

Tag: BA-EFSD-050

Type: Combination

Floor: Basement

Status: Fail

Reason:

- Damper rusted in place
- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In loading dock

Tag: BA-EFSD-050

Type: Combination

Floor: Basement

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In loading dock

Tag: BA-EFSD-051

Type: Combination

Floor: Basement

Status: Fail

Reason:

- Damper rusted in place
- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In loading dock

Tag: BA-EFSD-051

Type: Combination

Floor: Basement

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside storage room across from nuclear med.

Tag: BA-EFSD-054

Type: Combination

Floor: Basement

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

Inside storage room across from nuclear med.

Tag: BA-EFSD-054

Type: Combination

Floor: Basement

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside storage room across from nuclear med.

Tag: BA-EFSD-055

Type: Combination

Floor: Basement

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside trash chute

Tag: BC-FD-071

Type: Fire

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside storage unit #D6

Tag: BD-FD-019

Type: Fire

Floor: Basement

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

Inside ingredient control room
#D33

Tag: BD-ESD-028

Type: Smoke

Floor: Basement

Status: Fail

Reason:

- No Power Wired to Actuator



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above cash register inside retail store

Tag: BD-ESD-053

Type: Smoke

Floor: Basement

Status: Fail

Reason:

- Inoperable Actuator
- No Power Wired to Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Above double doors to cafeteria

Tag: BD-ESD-064

Type: Smoke

Floor: Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Left of cash register inside retail store

Tag: BD-ESD-073

Type: Smoke

Floor: Basement

Status: Non-Accessible

Reason:

- Existing drywall hatch too small, needs bigger drywall hatch to access damper



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

Left of cash register inside retail store

Tag: BD-ESD-073

Type: Smoke

Floor: Basement

Status: Non-Accessible

Reason:

- Hard Ceiling, needs drywall hatch



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Left of cash register inside retail store

Tag: BD-ESD-074

Type: Smoke

Floor: Basement

Status: Non-Accessible

Reason:

- Existing drywall hatch too small, needs bigger drywall hatch to access damper



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

Left of cash register inside retail store

Tag: BD-ESD-074

Type: Smoke

Floor: Basement

Status: Non-Accessible

Reason:

- Hard Ceiling, needs drywall hatch



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In north side of sub basement

Tag: SBA-EFSD-047

Type: Combination

Floor: Sub Basement

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In north side of sub basement

Tag: SBA-EFSD-048

Type: Combination

Floor: Sub Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In north side of sub basement

Tag: SBA-EFSD-049

Type: Combination

Floor: Sub Basement

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In north side of sub basement

Tag: SBA-EFSD-050

Type: Combination

Floor: Sub Basement

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside sub basement center location

Tag: SBA-EFSD-060

Type: Combination

Floor: Sub Basement

Status: Fail

Reason:

- Inoperable Actuator
- Access door rusted shut, Access door installation not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside stairwell #1

Tag: 1A-ESD-131

Type: Smoke

Floor: 1st

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to room
#A101

Tag: 1A-ESD-163

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator
- No Power Wired to Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

Above double doors to room
#A101

Tag: 1A-ESD-163

Type: Smoke

Floor: 1st

Status: Non-Accessible

Reason:

- Pipes blocking, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway near room #B115

Tag: 1B-FD-118

Type: Fire

Floor: 1st

Status: Pass



Before Inspection



After Inspection




Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

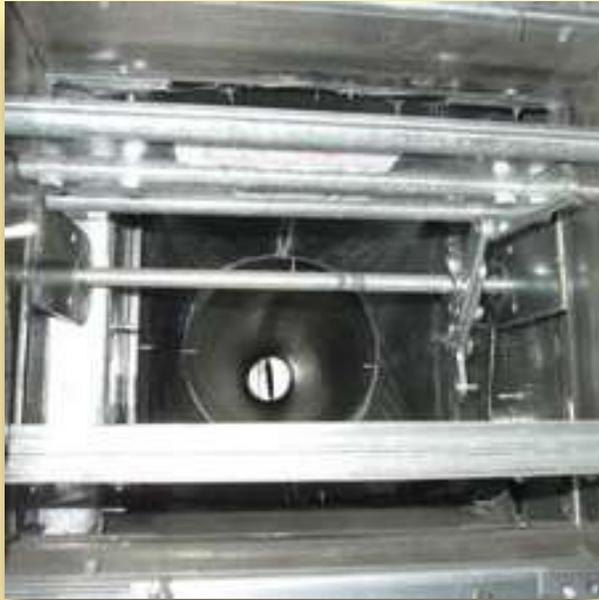

Before Inspection



After Inspection

Outside of room #B147

Tag: 1B-EFSD-255

Type: Combination

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator
- No Power Wired to Actuator



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Outside of room #B147C

Tag: 1B-EFSD-256

Type: Combination

Floor: 1st

Status: Fail

Reason:

- No Power Wired to Actuator
- No access door



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014

Outside of room #B147C

Tag: 1B-EFSD-256

Type: Combination

Floor: 1st

Status: Fail

Reason:

- No Air to Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway near room #B158

Tag: 1B-ESD-111

Type: Smoke

Floor: 1st

Status: Pass



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway near room #B115

Tag: 1B-PSD-117

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- No Air to Actuator
- Not Enough Air to Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

In hallway near room #B115

Tag: 1B-PSD-117

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- No Air to Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Outside of room #C168

Tag: 1C-FD-157

Type: Fire

Floor: 1st

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway across from room
#130

Tag: 1C-FD-164

Type: Fire

Floor: 1st

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway between rooms
#C137 and #C139

Tag: 1C-ESD-101

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In hallway between rooms
#C137 and #C139

Tag: 1C-ESD-101

Type: Smoke

Floor: 1st

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside room #C139

Tag: 1C-ESD-103

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

Inside room #C139

Tag: 1C-ESD-103

Type: Smoke

Floor: 1st

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway between rooms
#C137 and #C139

Tag: 1C-ESD-104

Type: Smoke

Floor: 1st

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway between rooms
#C137 and #C139

Tag: 1C-ESD-106

Type: Smoke

Floor: 1st

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway inside day hospital

Tag: 1C-ESD-120

Type: Smoke

Floor: 1st

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside day hospital

Tag: 1C-ESD-153

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

Inside day hospital

Tag: 1C-ESD-153

Type: Smoke

Floor: 1st

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside day hospital

Tag: 1C-ESD-156

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

Inside day hospital

Tag: 1C-ESD-156

Type: Smoke

Floor: 1st

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside stairwell near service elevator and room #D110

Tag: 1D-FD-162

Type: Fire

Floor: 1st

Status: Non-Accessible

Reason:

- Existing drywall hatch too small, needs bigger drywall hatch to access damper



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Outside of room #D119

Tag: 1D-FD-165

Type: Fire

Floor: 1st

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway

Tag: 1D-EFSD-115

Type: Combination

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside escort room #D111

Tag: 1D-ESD-125

Type: Smoke

Floor: 1st

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors near room #D1110A

Tag: 1D-ESD-144

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside room #D124

Tag: 1D-ESD-161

Type: Smoke

Floor: 1st

Status: Fail

Reason:

- Actuator missing



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to room
#A209

Tag: 2A-FD-235

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #A

Tag: 2A-FD-236

Type: Fire

Floor: 2nd

Status: Fail

Reason:



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #A

Tag: 2A-FD-237

Type: Fire

Floor: 2nd

Status: Pass



Before Inspection



After Inspection



**Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203**

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside mechanical room #A

Tag: 2A-FD-238

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside mechanical room #A

Tag: 2A-FD-239

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to ward #2D2

Tag: 2A-FD-244

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to ward #2D2

Tag: 2A-FD-245

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside mechanical room #266

Tag: 2A-FD-246

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #266

Tag: 2A-FD-247

Type: Fire

Floor: 2nd

Status: Pass



Before Inspection



After Inspection



**Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203**

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

Inside mechanical room #266

Tag: 2A-FD-248

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #266

Tag: 2A-PSD-249

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- No Air to Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014

Inside mechanical room #266

Tag: 2A-PSD-249

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- No Air to Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Outside of mechanical room #B255A

Tag: 2B-FD-201

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection

Outside of mechanical room
#B255A

Tag: 2B-FD-201

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- No access door, access door install not authorized
- metal too thick - no power close - needs large round



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Outside of mechanical room
#B255A

Tag: 2B-FD-203

Type: Fire

Floor: 2nd

Status: Fail

Reason:



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors near room #B205

Tag: 2B-FD-205

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors near room #B205

Tag: 2B-FD-206

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

**Outside of mechanical room
#B255A**

Tag: 2B-ESD-254

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- Inoperable Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

Outside of mechanical room
#B255A

Tag: 2B-ESD-254

Type: Smoke

Floor: 2nd

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

Above double doors to mental health room #C214

Tag: 2C-FD-207

Type: Fire

Floor: 2nd

Status: Pass



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to mental health room #C214

Tag: 2C-FD-208

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Above double doors

Tag: 2C-FD-209

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors

Tag: 2C-FD-210

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors near room
#C220

Tag: 2C-FD-211

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors near room
#C220

Tag: 2C-FD-212

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #C216

Tag: 2C-FD-214

Type: Fire

Floor: 2nd

Status: Fail

Reason:

- Damper rusted in place



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside mechanical room #C216

Tag: 2C-FD-215


Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized

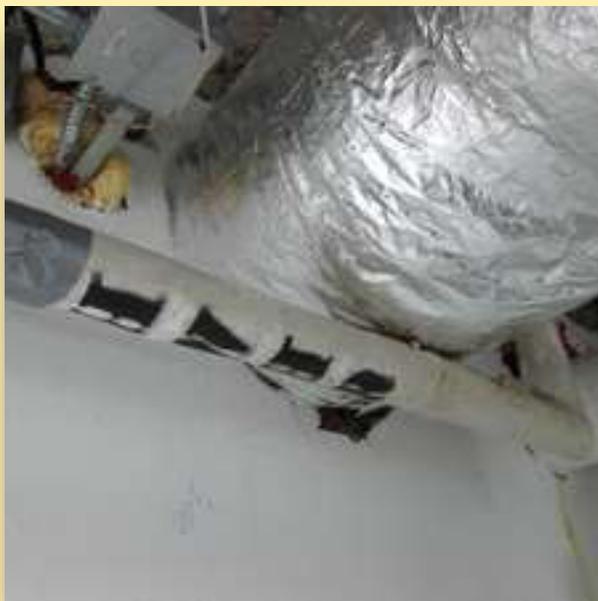

After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #C216

Tag: 2C-FD-216

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



Before Inspection



After Inspection




Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

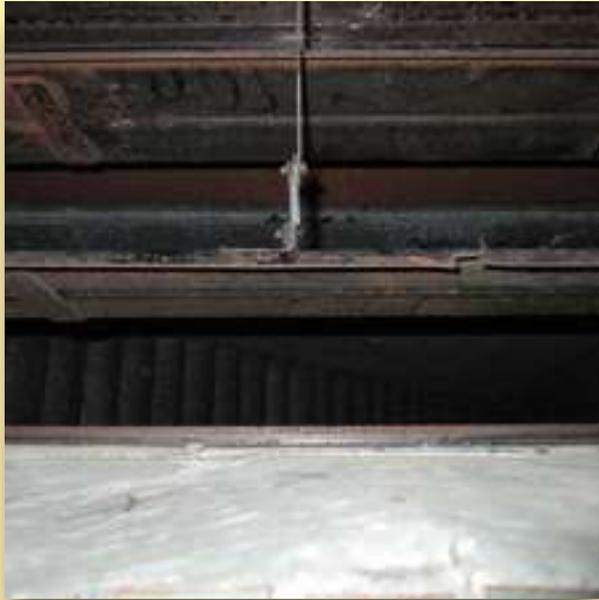

Before Inspection



After Inspection

Inside mechanical room near men's restroom

Tag: 2C-FD-221

Type: Fire

Floor: 2nd

Status: Pass



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside men's restroom #C202

Tag: 2C-FD-222

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Existing drywall hatch too small, needs bigger drywall hatch to access damper



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside mechanical room near
men's restroom

Tag: 2C-FD-223

Type: Fire

Floor: 2nd

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside rec. room near metal kitchen window

Tag: 2C-FD-224

Type: Fire

Floor: 2nd

Status: Fail

Reason:

- Bound in tracks (racking)



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Inside room #C203E

Tag: 2C-FD-226

Type: Fire

Floor: 2nd

Status: Pass



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Across from room #C275

Tag: 2C-FD-231

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

Above double doors to mental health room #C214

Tag: 2C-FD-252

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:

- Longer than arm's reach, access door install not authorized
- No access door, access door install not authorized



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

In hallway near double doors
and pharmacy

Tag: 2C-ESD-218

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- Inoperable Actuator



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In hallway near double doors
and pharmacy

Tag: 2C-ESD-218

Type: Smoke

Floor: 2nd

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection



After Inspection

In hallway near double doors
and pharmacy

Tag: 2C-ESD-219

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- Inoperable Actuator



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair



New installation

In hallway near double doors
and pharmacy

Tag: 2C-ESD-219

Type: Smoke

Floor: 2nd

Status: Pass

Repair Performed: Actuator Installed

Actuator Make: Belimo

Actuator Model: FSLF

Actuator Type: Electric

Actuator Voltage: 120V



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

Inside mechanical room #C216

Tag: 2C-PFSD-213

Type: Combination

Floor: 2nd

Status: Fail

Reason:

- Inoperable Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Open after repair



Closed after repair



Re-opened after repair

Inside mechanical room #C216

Tag: 2C-PFSD-213

Type: Combination

Floor: 2nd

Status: Fail

Repair Performed: Actuator Installed

Actuator Make: Siemens

Actuator Model: NA

Actuator Type: Pneumatic

Actuator Voltage: N/A



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to room
#D265

Tag: 2D-FD-242

Type: Fire

Floor: 2nd

Status: Fail

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013



Before Inspection

Above double doors to room
#D265

Tag: 2D-FD-243

Type: Fire

Floor: 2nd

Status: Non-Accessible

Reason:



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

December 09, 2014 – December 15, 2014



Before Inspection



After Inspection

Above double doors to room
#D265

Tag: 2D-FD-243

Type: Fire

Floor: 2nd

Status: Fail

Reason:

- Damper rusted in place



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

COMPREHENSIVE FIRE AND SMOKE DAMPER REPORT

Main Hospital : VA Caribbean Health System

May 29, 2013 – June 14, 2013

In hallway near room #D212

Tag: 2D-ESD-250

Type: Smoke

Floor: 2nd

Status: Fail

Reason:

- Inoperable Actuator



Before Inspection



After Inspection



Corporate Office:
908 South 8th Street
Suite 500
Louisville, KY 40203

888-675-4519

www.LifeSafetyServices.com