

LOUIS STOKES VA MEDICAL CENTER, CLEVELAND												
STEAM TRAP MONITORING SYSTEM, INSULATION AND PIPING UPGRADES												
STEAM TRAP TAG NO.	LOCATION	TRAP DRAWING REFERENCE NO.	AREA	TRAP TYPE	ELEV. AFF.	TRAP MODEL, MFG. & PIPE SIZE	P IN	EQUIPMENT SERVED	COND	REMARKS		
131	RESEARCH PENTHOUSE #40A AC-25 STEAM COIL UPPER	3-2-8	8	F	3	1" SPIRAX FT-15	14M	STEAM COIL	OK	HAS NEW 1" SPIRAX FT-15 FLAT & THERMOSTATIC STEAM TRAP WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 FACE PLATE KIT. SHOULD HAVE V-STRAINER TO PROTECT STEAM TRAP AND TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER TO PROTECT COIL. INSPECTED 7/27/12.		
132	RESEARCH PENTHOUSE #40A AC-25 STEAM COIL MIDDLE	3-2-8	8	F	2	1" SPIRAX FT-15	14M	STEAM COIL	OK	HAS NEW 1" SPIRAX FT-15 FLAT & THERMOSTATIC STEAM TRAP WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 FACE PLATE KIT. SHOULD HAVE V-STRAINER TO PROTECT STEAM TRAP AND TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER TO PROTECT COIL. INSPECTED 7/27/12.		
133	RESEARCH PENTHOUSE #40A AC-25 STEAM COIL LOWER	3-2-8	8	F	1	1" SPIRAX FT-15	14M	STEAM COIL	OK	HAS NEW 1" SPIRAX FT-15 FLAT & THERMOSTATIC STEAM TRAP WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 FACE PLATE KIT. SHOULD HAVE V-STRAINER TO PROTECT STEAM TRAP AND TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER TO PROTECT COIL. INSPECTED 7/27/12.		
134	RESEARCH PENTHOUSE #40A AC-25 STEAM COIL SUPPLY DRIP	3-2-8	8	B	1	3/4" SPIRAX B1H-125	14	STEAM MAIN DRIP	OK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
135	RESEARCH PENTHOUSE #40A AC-25 REHEAT COIL UPPER	3-2-8	8	F	3	2" SPIRAX FT-15	14M	STEAM COIL	OK	HAS NEW 2" SPIRAX FT-15 WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. SHOULD HAVE V-STRAINER TO PROTECT TRAP. NO VACUUM BREAKER PRESENT. INSTALL TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER. INSPECTED 7/27/12.		
136	RESEARCH PENTHOUSE #40A AC-25 REHEAT COIL MIDDLE	3-2-8	8	F	2	2" SPIRAX FT-15	14M	STEAM COIL	OK	HAS NEW 2" SPIRAX FT-15 WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. SHOULD HAVE V-STRAINER TO PROTECT TRAP. NO VACUUM BREAKER PRESENT. INSTALL TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER. INSPECTED 7/27/12.		
137	RESEARCH PENTHOUSE #40A AC-25 REHEAT COIL LOWER	3-2-8	8	F	1	2" SPIRAX FT-15	14M	STEAM COIL	LK	REPAIR DEFECTIVE STEAM TRAP WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. SHOULD HAVE V-STRAINER TO PROTECT TRAP. NO VACUUM BREAKER PRESENT. INSTALL TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER TO PROTECT COIL. INSPECTED 7/27/12.		
138	RESEARCH PENTHOUSE #40A AC-25 REHEAT COIL SUPPLY DRIP	3-2-8	8	B	2	3/4" SPIRAX B1H-125	10	STEAM MAIN DRIP	CP	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
139	RESEARCH PENTHOUSE #40A REHEAT COIL HUMIDIFIER	3-2-8	8	D	1	3/4" PROFFICIENT TECHNOLOGIES TGG4082	10	HUMIDIFIER DRIP	CO	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH NEW 3/4" SPIRAX B1H-125 OR 3/4" VACUUM BREAKER PRESENT. INSTALL TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER. INSPECTED 7/27/12.		
140	RESEARCH PENTHOUSE #40A REHEAT COIL UNIT HEATER EAST WALL	3-2-8	8	F	12	3/4" SPIRAX FT-30	14	UNIT HEATER	COILK	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. CHECK VALVE BREAKER OPEN TO ATMOSPHERE AT COIL OUTLET. HAS DIELECTRIC UNION EVIDENCE OF LEAKAGE. REPLACE UNION. INSPECTED 7/27/12.		
141	BASEMENT K-14 CART WASHER SUPPLY DRIP	3-B-1	1	F	6	1" NICHOLSON FTN-15	70	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. INSPECTED 8/11/12.		
142	BASEMENT K-17 CART WASHER SUPPLY DRIP	3-B-1	1	B	2	3/4" SPIRAX B1H-125	70	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. HAS ELEVATED CONDENSATE. 6 FT. OF 1" TO 1/2" BARE STEAM PIPE NEEDS INSULATION. INSPECTED 7/27/12.		
143	BASEMENT K-17 CART WASHER HEAT EXCHANGER	3-B-1	1	D	2	3/4" WATSON MCD WD-600	70M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 STEAM TRAP WITH 3/4" FLAT & THERMOSTATIC STEAM TRAP WITH 3/4" V-STRAINER. SHOULD HAVE STEAM SERVICE VACUUM BREAKER INSTALLED AT HEAT EXCHANGER OUTLET. INSTALL TUNSTALL VES34 VACUUM BREAKER. INSPECTED 8/11/12.		
144	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL L.P. DRIP	3-B-1	1	B	6	3/4" SPIRAX B1H-125	15	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. HAS ELEVATED CONDENSATE. HAS COPPER CONDENSATE DISCHARGE PIPING & DIELECTRIC UNION. INSPECTED 8/11/12.		
145	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL AC-18 STEAM COIL	3-B-1	1	F	8	1" NICHOLSON FTN-15	10M	STEAM COIL	CO	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. CHECK VALVE BREAKER OPEN TO ATMOSPHERE AT COIL OUTLET. HAS DIELECTRIC UNION EVIDENCE OF LEAKAGE. REPLACE UNION. INSPECTED 8/11/12.		
146A	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL PIV DRIP	3-B-1	1	F	2	3/4" NICHOLSON FTN-15	10	STEAM MAIN DRIP	OK	STEAM TRAP OK. WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. NEW AG. INSPECTED 8/11/12.		
146	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL L.P. DRIP	3-B-1	1	F	7	3/4" NICHOLSON FTN-15	10	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. CONDENSATE SLIGHTLY ELEVATED 12". INSPECTED 8/11/12.		
147	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL L.P. DRIP	3-B-1	1	1	8	3/4" SPIRAX FT-15	10	UNIT HEATER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. INSPECTED 8/11/12.		
148	BASEMENT STARWELL #1 K-18 L.P. DRIP TO STEAM COIL UNIT	3-B-1	1	F	12	3/4" NICHOLSON FTN-15	10	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. INSPECTED 8/11/12.		
149	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL HEAT EXCHANGER	3-B-1	1	F	2	3/4" NICHOLSON FTN-15	10M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT OR REPLACE WITH NEW 3/4" SPIRAX FT-15 SERVICE FLUSH TANK. PIPED IMPROPERLY. CONDENSATE PUMP IMPROPERLY PIPED. REPAIR ENTIRE HEAT EXCHANGER & CONDENSATE PUMP FOR GRAVITY DRAINAGE. INSPECTED 8/11/12.		
150	BASEMENT STARWELL #1 K-18 EQUIPMENT RAIL HEAT EXCHANGER DRIP TRAP	3-B-1	1	F	5	3/4" NICHOLSON FTN-15	10	STEAM MAIN DRIP	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 FACE PLATE REPAIR KIT. STEAM SAFETY VALVE DISCHARGE PIPED IMPROPERLY. RE-PIPE. INSPECTED 8/11/12.		
151	K-14 PENTHOUSE UNIT HEATER	3-PH-2	2	F	9	3/4" SPIRAX FT-30	10	UNIT HEATER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 FACE PLATE KIT. HAS COPPER CONDENSATE DISCHARGE PIPING WITH DIELECTRIC UNION. INSPECTED 7/27/12.		
152	MAN PENTHOUSE STARWELL #5 HEAT EXCHANGER SUPPLY DRIP	3-PH-2	2	B	6	3/4" SPIRAX B1H-125	10	STEAM MAIN DRIP	OK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
153	MAN PENTHOUSE STARWELL #5 HEAT EXCHANGER	3-PH-2	2	F	2	2" DUNHAM BUSH 30-5A	10M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 REPAIR KIT. STEAM TRAP IS MOUNTED IN PARALLEL TO TRAP #183. REMOVE 3/4" AIR VENT AT OUTLET & REPLACE WITH TUNSTALL VES34 STEAM SERVICE VACUUM BREAKER OPEN TO ATMOSPHERE. CHECK VALVE IN REVERSE. USED AS VACUUM BREAKER IN SHELL. PRESSURE GAUGE IS BROKEN. INSPECTED 7/27/12.		
154	MAN PENTHOUSE STARWELL #5 HEAT EXCHANGER	3-PH-2	2	F	3	2" DUNHAM BUSH 30-5A	10M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 REPAIR KIT. STEAM TRAP IS MOUNTED IN PARALLEL TO TRAP #183. INSPECTED 7/27/12.		
155	MAN PENTHOUSE STARWELL #5 P19 MAR-10 STEAM COIL LEFT. AC-18	3-PH-2	2	F	2	2" TUNSTALL TLA-FT8-15	10M	STEAM COIL	OK	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH #8R-3A-15 FACE PLATE REPAIR KIT. TRAP HAS OUTLET DIELECTRIC UNIONS. HAS STEAM SERVICE VACUUM BREAKER AT COIL OUTLET. INSPECTED 7/27/12.		
156	MAN PENTHOUSE STARWELL #5 P19 MAR-10 STEAM COIL RIGHT. AC-18	3-PH-2	2	F	2	2" TUNSTALL TLA-FT8-15	10M	STEAM COIL	CO	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH #8R-3A-15 FACE PLATE REPAIR KIT. TRAP HAS OUTLET DIELECTRIC UNIONS. HAS STEAM SERVICE VACUUM BREAKER AT COIL OUTLET. INSPECTED 7/27/12.		
157	MAN PENTHOUSE STARWELL #5 P19 MAR-10 STEAM COIL LEFT. AC-18	3-PH-2	2	F	2	2" TUNSTALL TLA-FT8-15	10M	STEAM COIL	CO	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH #8R-3A-15 FACE PLATE REPAIR KIT. TRAP HAS OUTLET DIELECTRIC UNIONS. HAS STEAM SERVICE VACUUM BREAKER AT COIL OUTLET. INSPECTED 7/27/12.		
158	MAN PENTHOUSE STARWELL #5 P19 MAR-10 STEAM COIL RIGHT. AC-18	3-PH-2	2	F	2	2" TUNSTALL TLA-FT8-15	10M	STEAM COIL	CO	STEAM TRAP IS COOL OUT OF SERVICE. IF REQUIRED, REPAIR WITH #8R-3A-15 FACE PLATE REPAIR KIT. TRAP HAS OUTLET DIELECTRIC UNIONS. HAS STEAM SERVICE VACUUM BREAKER AT COIL OUTLET. INSPECTED 7/27/12.		
159	MAN PENTHOUSE STARWELL #5 P19 H.P. DRIP TO PIV STATION	3-PH-2	2	B	2	3/4" SPIRAX B1H-125	115	STEAM MAIN DRIP	OKLK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
160	MAN PENTHOUSE STARWELL #5 AC-18M DRIP TO PIV STATION	3-PH-2	2	B	2	3/4" SPIRAX B1H-125	25	STEAM MAIN DRIP	OK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
161	MAN PENTHOUSE STARWELL #5 AC-18M L.M. DRIP TO PIV STATION	3-PH-2	2	B	4	3/4" SPIRAX B1H-125	25	STEAM MAIN DRIP	BT	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
162	MAN PENTHOUSE STARWELL #5 L.P. SUPPLY TO HEAT EXCHANGER-1 & 2 HEAT EXCHANGERS	3-PH-2	2	B	9	3/4" SPIRAX B1H-125	10	STEAM MAIN DRIP	LK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
163	MAN PENTHOUSE STARWELL #5 PERIMETER HEAT EACH DRIP	3-PH-2	2	D	12	3/4" PROFFICIENT TECHNOLOGIES TGG45A8	10	STEAM MAIN DRIP	OKLK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
164	MAN PENTHOUSE STARWELL #5 PERIMETER HEAT EXCHANGER	3-PH-2	2	F	3	2" WATSON MCD FT-30	10M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. HAS VACUUM BREAKER IN SHELL. WHEN TAG. INSPECTED 7/27/12.		
165	MAN PENTHOUSE STARWELL #5 PERIMETER HEAT EXCHANGER	3-PH-2	2	F	3	2" WATSON MCD FT-30	10M	HEAT EXCHANGER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR STEAM TRAP WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. HAS VACUUM BREAKER IN SHELL. WHEN TAG. INSPECTED 7/27/12.		
166	MAN PENTHOUSE STARWELL #5 ENTRANCE UNIT HEATER	3-PH-2	2	F	22	3/4" ARABSTRONG 15-83	10	UNIT HEATER	OK	STEAM TRAP IS OK. WHEN WORK. REPAIR WITH TUNSTALL #8R-3A-15 STEAM TRAP REPAIR KIT. HAS VACUUM BREAKER IN SHELL. WHEN TAG. INSPECTED 7/27/12.		
167	MAN PENTHOUSE STARWELL #5 AC-17 PIV H.P. DRIP	3-PH-2	2	B	7	1 1/2" SPIRAX B1H-125	115	STEAM MAIN DRIP	OK	HAS NEW 1 1/2" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
168	MAN PENTHOUSE STARWELL #5 AC-17 PIV L.P. DRIP	3-PH-2	2	B	7	3/4" SPIRAX B1H-125	10	STEAM MAIN DRIP	OK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
169	MAN PENTHOUSE STARWELL #5 AC-17 PIV M.P. DRIP	3-PH-2	2	B	10	1 1/2" SPIRAX B1H-125	25	STEAM MAIN DRIP	OK	HAS NEW 1 1/2" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. INSPECTED 7/27/12.		
170	MAN PENTHOUSE STARWELL #5 AC-17 PIV L.P. DRIP TO HEAT EXCHANGER	3-PH-2	2	D	8	3/4" SPIRAX B1H-125	10	STEAM MAIN DRIP	OKLK	HAS NEW 3/4" SPIRAX B1H-125 STEAM TRAP IS OK. WHEN WORK. REPAIR WITH SPIRAX #800M REPAIR KIT. 2" WPT GATE VALVE LEAKS AT BRACKET. RE-PIPE WITH 2" STEAM SERVICE BALL VALVE. INSPECTED 7/27/12.		


NOTES:

1. REMEAS REQUIRED PER REMARKS COLUMN.
2. REPIPE SAFETY VALVE DISCHARGE.

- COLUMN REFERENCE NOTES:
- ① FURNISH AND INSTALL AN ACOUSTIC WIRELESS STEAM TRAP MONITORING SENSOR PER SPECIFICATIONS. SECTION 222213.
② REPLACE OR REPAIR STEAM TRAP IN ACCORDANCE WITH DESCRIPTION IN REMARKS COLUMN.
③ REMOVE STEAM TRAP AND ALL ABANDONED CONDENSATE PIPING TO A POINT WHERE THE CONDENSATE LINE IS LIVE. CAP.
④ REPAIR STEAM CONDENSATE LEAK IN ACCORDANCE WITH DESCRIPTION IN REMARKS COLUMN.
⑤ CONDENSATE PIPING, BEHIND THE WALLS OR IN ATTIC AS DESCRIBED IN THE REMARKS COLUMN. INVESTIGATE AND DETERMINE THE REASON FOR ANY OTHER NON-CONFORMING STEAM TRAP THAT WERE FOUND TO BE COOL. FIX ALL ITEMS FOUND TO BE NEEDING REPAIR. FOR PURPOSES OF THE CONTROL VALVES REQUIRE REPAIRS OR REPLACEMENT.)
⑥ REPLACE THE EXISTING COPPER PIPING WITH NEW STEEL PIPE AND REPLACE THE EXISTING DIELECTRIC UNIONS AND WIPERS WITH EQUIVALENT SIZES. SEE THE REMARKS COLUMN FOR REQUIRED WORK. SEE THE SPECIFICATIONS FOR THE REQUIRED MATERIALS AND FITTINGS. INSULATE ALL NEW & EXISTING BARE PIPE.
⑦ FURNISH AND INSTALL NEW STEAM VACUUM BREAKERS IN ACCORDANCE WITH THE REMARKS COLUMN.

CONSULTANTS:

FREDRICK, FREDRICK & HELLER
10000 WILSON AVENUE
672 EAST TOLATION ROAD
BROADVIEW HTS., OHIO 44147
Tel: (440) 344-2666
Fax: (440) 344-2666

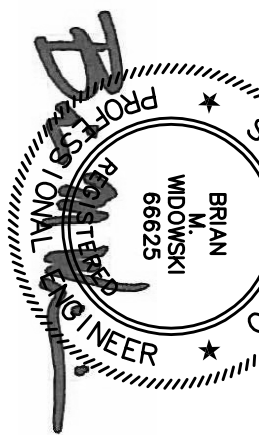

ARCHITECT:

Drawing Title
STEAM TRAP AND WORK SCHEDULE
TRAPS B31-170

Approved: Project Director

Project Title
STEAM TRAP MONITORING,
INSULATION AND PIPING
UPGRADES
LOCATION
VAMC - WADE PARK
Date
12-21-12
Checked
WPH
Drawn
JMF

Project Number
541-12-115
Building Number
1
Drawing Number
2-04

Office of
Facilities
Management

