

- REPORT ANY AND ALL DISCREPANCIES TO THE COR.
- PROCEED WITH CARE AND CAUTION DURING DEMOLITION TO AVOID AND MINIMIZE DAMAGE TO EXISTING CONSTRUCTION, MATERIALS, SYSTEMS AND FINISHES TO REMAIN.
  - REFER TO AE601 FOR WINDOW TYPES. CONTRACTOR SHALL FIELD VERIFY WINDOW OPENING SIZES AND CONDITIONS PRIOR TO COMMENCEMENT OF WORK.
  - REMOVE ALL EXISTING SECURITY SCREENING EXCEPT AT BUILDING 7 UNLESS NOTED OTHERWISE (UNO).
  - ALL EXISTING BASEMENT LEVEL LOUVERS TO REMAIN. CLEAN AND REPAINT TO MATCH EXISTING CAMPUS STANDARD COLOR, COORDINATE WITH COR.
  - EXISTING WINDOWS TO REMAIN ARE NOT TAGGED AND REQUIRE NO WORK UNDER THIS CONTRACT.
  - HALF-TONE OBJECTS, LABELS OR NOTES TYPICALLY REPRESENT EXISTING ITEMS TO REMAIN.
  - VERIFY CONDITION OF EXISTING INTERIOR AND EXTERIOR HEAD, JAMB AND SILL AT EACH WINDOW LOCATION SCHEDULED FOR REPLACEMENT. PATCH, REPAIR OR REPLACE PERIMETER COMPONENTS AS REQUIRED BY CONDITION TO MATCH EXISTING ADJACENT MATERIALS AND FINISHES.
  - ALL KEY NOTES MAY NOT BE APPLICABLE TO EVERY SHEET.

**DEMOLITION KEY NOTES:**


- REMOVE EXISTING WINDOW AND OR INFILL MATERIAL.
- REMOVE EXISTING WINDOW AND SECURITY SCREEN. CLEAN AND REPLACE EXISTING SECURITY SCREEN AT THIS LOCATION.

**KEY NOTES:**

- EXISTING WINDOW TO REMAIN. REPAIR, PATCH, PAINT AND SEAL EXISTING INTERIOR WINDOW TRIM TO GREATEST EXTENT POSSIBLE. COORDINATE TRIM REPLACEMENT WITH COR WHEN REPAIRS ARE NOT REASONABLE.
- PROVIDE OBSCURE GLASS AT THIS LOCATION.
- PROVIDE REPLACEMENT INFILL MATERIAL BELOW WINDOW TO MATCH THE INFILL MATERIAL AT LOCATIONS ABOVE.
- WINDOW INSTALLATION FROM INTERIOR AT THIS LOCATION. CLEAN AND REPAINT EXISTING EMBEDDED SECURITY BARS TO MATCH EXISTING CAMPUS STANDARD COLOR, COORDINATE WITH COR.

**LEGEND:**

- EXISTING CONSTRUCTION TO REMAIN
- DEMOLITION
- NEW WINDOW OR PANEL
- EL EXISTING LOUVER TO REMAIN
- # WINDOW TYPE TAG
- PR INSULATED PANEL TAG

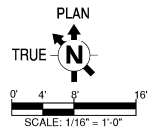

**BID DOCUMENTS**

<b>CONSULTANTS:</b>		<b>ARCHITECT/ENGINEERS:</b>		<b>Drawing Title</b>		<b>Project Title</b>		<b>Project Number</b>		<b>Office of Construction and Facilities Management</b>	
				<b>B9 - WINDOW DEMOLITION / REPLACEMENT PLANS</b>		<b>ENERGY AUDIT CORRECTIONS PHASE I</b>		<b>666-15-10</b>			
				<b>AES Group, Inc.</b> 3375A SOUTH PULASKI AVE. SUITE 100 PARKER, COLORADO 80138 PH: 303.541.2022 WWW.AES-GRP.COM		<b>Approved Project Director</b>		<b>Location</b>		<b>Drawing Number</b>	
						<b>DOUGLAS G. LOPFEN, SUPERVISORY STAFF ENGINEER/ENERGY MANAGER</b>		<b>FT. MCKENZIE, SHERIDAN, WY</b>		<b>AE107</b>	
						<b>Plant Operations Maint + Repair Plus</b>		<b>Date</b>		<b>Checked</b>	
						<b>BMU: DOUGLASLOPFEN@AES.COM</b>		<b>JANUARY 2015</b>		<b>RJO</b>	
								<b>Drawn</b>		<b>LED</b>	
								<b>Dep 9 of 17</b>			

Window has an electrical conduit and outside air temp sensor. Is the sensor to be relocated to the exterior of the infill panel?

**1. BUILDING 9 - WINDOW DEMOLITION PLAN**  
AE107 SCALE: 1/16" = 1'-0"

**2. BUILDING 9 - WINDOW REPLACEMENT PLAN**  
AE107 SCALE: 1/16" = 1'-0"