



**Adelaide Environmental Health Associates, Inc.**

**COMPREHENSIVE SURVEY FOR ASBESTOS CONTAINING  
MATERIALS**

**PERFORMED AT:**

**Building 19  
Veterans Affairs Medical Center  
1970 Roanoke Blvd  
Salem, Virginia 24153  
Adelaide Project No. VAMC: 10079.00-IN**

**PREPARED FOR:**

**Department of Veterans Affairs  
Veterans Affairs Medical Center  
1970 Roanoke Blvd  
Salem, Virginia 24153**

**PREPARED BY:**

**Adelaide Environmental Health Associates, Inc.  
1511 Route 22, Suite C24  
Brewster, New York 10509**

**DATED:**

**July 23, 2010**

**Submitted by:**



**Stephanie A. Soter  
President**

# **COMPREHENSIVE SURVEY FOR ASBESTOS CONTAINING MATERIALS**

## **TABLE OF CONTENTS**

<b>1.0</b>	<b>Background/Purpose</b>	<b>1</b>
<b>2.0</b>	<b>Executive Summary of Inspection Results</b>	<b>1</b>
<b>3.0</b>	<b>Asbestos Field Procedures and Analysis Methodology</b>	<b>3</b>
3.1	<b>Inspection</b>	<b>3</b>
3.2	<b>Sampling</b>	<b>3</b>
3.3	<b>Analysis</b>	<b>4</b>
<b>4.0</b>	<b>Conclusions and Recommendations</b>	<b>5</b>
<b>5.0</b>	<b>Areas not Accessible</b>	<b>5</b>
<b>6.0</b>	<b>Report Certifications</b>	<b>5</b>

## **APPENDICES**

<b>Tabular List of Positive Materials by Room</b>	<b>Appendix A</b>
<b>Asbestos Report Form</b>	<b>Appendix B</b>
<b>Asbestos Analytical Results and Chain of Custody Forms</b>	<b>Appendix C</b>
<b>Sample Location Map and Photos</b>	<b>Appendix D</b>
<b>Personnel and Laboratory Certifications</b>	<b>Appendix E</b>

## **1.0 BACKGROUND/PURPOSE**

Adelaide Environmental Health Associates, Inc. (Adelaide) was retained by The Department of Veterans Affairs Medical Center to conduct a comprehensive asbestos containing material (ACM) survey at the VA Medical Center (VAMC) in Salem, Virginia. This survey was based on the terms and conditions of Adelaide's proposal: VA-246-10-RQ-0293, dated April 19<sup>th</sup>, 2010. The survey was performed to meet the needs of the VAMC to have a room by room inspection of each building owned and operated by the facility, so it can be determined which rooms are asbestos free and which rooms have ACM. All interior and exterior accessible spaces were inspected for the presence of friable and non-friable ACM. Inspection activities conform to the requirements of the Environmental Protection Agency (EPA) Asbestos Hazard Emergency Response Act (AHERA) (40 CFR Part 763), OSHA, all other state, local and VA requirements. Adelaide met with Cary Schiltz, the VAMC Industrial Hygienist, and discussed building history; reviewed asbestos abatement projects and the most recent asbestos survey performed in the facility. This asbestos inspection report provided by the VAMC contained limited sample results for each building at the Salem VAMC. Adelaide was able to utilize this report to reduce the amount of redundant sampling but also to allow a thorough room by room three (3) year AHERA asbestos survey, as required by VAMC. Additional sampling was performed in areas in order to provide the VAMC with the most up to date comprehensive survey of each building on the property. The asbestos survey was performed from June 7 – 18, 2010 by Adelaide representative James Reber and Tom Ferro (certified asbestos inspectors).

## **2.0 EXECUTIVE SUMMARY OF INSPECTION RESULTS**

Building 19 is located on the VAMC campus located at 1970 Roanoke Blvd, Salem, Virginia 24153. It is a two story structure, constructed of brick and built circa 1933. Following the scope of work that was provided from the VAMC, Adelaide inspected all accessible areas of Building 19. At the request of Cary Schiltz of Salem VAMC, no roof testing was conducted which could jeopardize water tightness and integrity; therefore all roofing materials are assumed asbestos containing materials until testing can prove otherwise. Adelaide collected fifty-seven (57) asbestos samples from the above-mentioned areas. Based on the results of Adelaide's asbestos survey and the limited survey and sample results provided by the facility, the following building materials were found to contain asbestos and are represented in the following Table 2.0 – Summary of Asbestos Containing Materials. All materials which tested negative for asbestos can be found in the Negative Material List. Refer to Appendix A for the Tabular List of Positive Materials by Room, which assesses the condition of each ACM as found at the time of this survey.

**Table 2.0 - Summary of Asbestos Containing Materials**

Material	Approximate Quantity	Location of Material	Asbestos Content and Type
Samples Taken by Adelaide Environmental			
Paper Wrap on Duct	50 SF	Attic of Apts. 19A and 19B on Galvanized exhaust duct. Material is extending into the floor and is possibly present in the walls.	80% Chrysotile
Pipe Insulation Inside Vertical Chases	10 LF* (more inside chases)	All Chases – visible from basements in Apt. 19A and 19B	4% Crocidolite and 10% Chrysotile (14% Total)
Floor Tile Mastic Associated with 12"x12" White Floor Tiles	1500 SF	Apartment 19A and 19B – Basement Room 1	8% Chrysotile
Kitchen Sink Basin Coating (Black)	10 SF (2 Sinks)	Kitchens 103 of Apts. 19A & 19B	6% Chrysotile
Exterior Door Caulk (window caulk is homogenous)	200 LF	All exterior doors and windows (homogenous with window caulk)	7% Chrysotile

\*Quantity observed

Based on our field observations, asbestos containing pipe insulation may be present within walls, above plaster ceilings and inside enclosed pipe chases.

### **Positive Homogenous Material List**

The following is a list of the homogenous areas that tested positive during this inspection:

- #3 – Paper Wrap on Duct
- #9 – Pipe Insulation Inside Vertical Chases
- #11 – Floor Tile Mastic associated with 12"x12" White Floor Tiles
- #14 – Kitchen Sink Basin Coating (black)
- #19 – Exterior Door Caulk (window caulk is homogenous)

### **Negative Material List**

The following is a list of the homogeneous areas that tested negative during this inspection:

- Brick Mortar
- Ceiling and Wall Plasters – Top and base Coats
- Window Glazing Compound
- Stone Mortar

- Fiberglass Pipe Insulation
- Attic Insulation Paper Backing
- Attic Insulation (fibrous and wool like)
- Linoleum backing leftover on kitchen floor
- 12"x12" white floor tiles
- Tar paper behind tub (accessed from chase door closet 201A)
- Millboard covering the attic insulation in Apt 19B
- Closet door panels in Entry of 19B
- Brown Linoleum and paper backing
- Tan Linoleum and paper backing
- White Linoleum

### **3.0 ASBESTOS FIELD PROCEDURES AND ANALYSIS METHODOLOGY**

#### **3.1 INSPECTION**

Guidelines used for the inspection were established by the U.S. Environmental Protection Agency (EPA) in the Guidance for Controlling Asbestos Containing Materials in Buildings, Office of Pesticides and Toxic Substances, DOC# 560/5-85-024 and 40 CFR Part 763, Asbestos Hazard Emergency Response Act (AHERA). Field information was organized as per the AHERA concept of a homogeneous area (HA); that is, suspect Asbestos Containing Materials (ACM) with similar age, appearance, and texture were grouped together, sampled and assessed for condition.

For the purposes of this inspection, suspect ACM has been placed in three material categories: thermal, surfacing, and miscellaneous.

Surfacing materials are those that are sprayed on, troweled on or otherwise applied to surfaces for fireproofing, acoustical, or decorative purposes (e.g., wall and ceiling plaster).

Thermal materials are those applied to heat pipes or other structural components to prevent heat loss or gain or prevent water condensation (e.g., pipe and fitting insulation, duct insulation, boiler flue).

Miscellaneous materials are interior building materials on structural components, structural members or fixtures, such as floor and ceiling tiles, etc. and do not include surfacing material or thermal system insulation.

#### **3.2 SAMPLING**

##### **SURFACING MATERIALS**

Surfacing materials were grouped into homogeneous sampling areas. A homogeneous area contains material that is uniform in color and texture and appears identical in every

other respect. Materials installed at different times belong to different sampling areas. Homogeneous areas were determined on per floor basis.

The following protocol was used for determining the number of samples to be collected:

- At least three bulk samples were collected from each homogeneous area that is 1,000 square feet or less.
- At least five bulk samples were collected from each homogeneous area that is greater than 1,000 square feet but less than or equal to 5,000 square feet.
- At least seven bulk samples were collected from each homogeneous area that is greater than 5,000 square feet.

#### THERMAL SYSTEM INSULATION (TSI)

The concept of homogeneous sampling areas applies equally well to thermal insulation as to surfacing material. A "typical" building may contain multiple insulated pipe runs from any combination of the following categories:

- Hot water supply and/or return
- Cold water supply
- Chilled water supply
- Steam supply and/or return
- Roof or system drain

The following protocol was used for determining the number of samples to be collected.

- Collect at least three bulk samples from each homogeneous area of thermal system insulation.
- Collect at least one bulk sample from each homogeneous area of patched thermal system insulation if the patched section is less than 6 linear or square feet.
- In a manner sufficient to determine whether the material is ACM or not ACM, collect a minimum of three bulk samples from each homogeneous insulated mechanical system tee, elbow, and valve.

Bulk samples are not collected from any homogeneous area where the certified inspector has determined that the thermal system insulation is fiberglass, foam glass, or rubber.

#### MISCELLANEOUS MATERIALS

Miscellaneous materials are grouped into different homogeneous areas and at least two bulk samples are collected from each homogeneous area as per the clarification letter from the EPA and the Professional Abatement Contractors of New York, Inc in November of 2007.

### **3.3 ANALYSIS**

Adelaide utilized AmeriSci laboratory in Richmond, VA for all bulk samples collected. AmeriSci holds accreditation from the National Institute of Standards and Technology (NIST) under the National Voluntary Laboratory Accreditation Program (NVLAP). Bulk samples of suspect ACM were analyzed by Polarized Light Microscopy (PLM) with dispersion staining, as described in 40 CFR Part 763 and the National Emissions Standard for Hazardous Air Pollutants (NESHAPS). All NOB samples were analyzed by utilizing PLM methodology.

### **4.0 CONCLUSIONS AND RECOMMENDATIONS**

This survey concluded that the materials listed in Table 2.0 – Summary of Asbestos Containing Materials, tested ***positive for the presence of***.

**Asbestos:** *These areas must be abated prior to building demolition or renovation if they are to be disturbed.*

### **5.0 AREAS NOT ACCESSIBLE**

Adelaide Environmental Health Associates inspected and sampled materials which were visible and/or accessible to the survey team. Adelaide does not inspect physically inaccessible areas, such as between walls, above fixed ceilings, under concrete slabs, etc. This report makes no representations as to the content of these areas or materials.

All materials present in those not accessible areas shall be assumed positive until tested.

### **6.0 REPORT CERTIFICATIONS**

Adelaide Environmental Health Associates certifies that the information contained herein is based on the physical and visual inspections conducted by Adelaide and data collected during the inspection survey.

**APPENDIX A**

**TABULAR LIST OF POSITIVE**

**MATERIALS BY ROOM**

## APPENDIX A - TABULAR LIST OF POSITIVE MATERIALS BY ROOM

Space #	Homogeneous Area	Material Description	Quantity	Condition Response Action
Apt 19A Room 1	9	Pipe Insulation Inside Vertical Chases	10 LF(visible)	Good/Defer Action/None Required
	11	Floor Tile Martic Associated with 12"x12" White Floor Tiles	750 SF	Good/Defer Action/None Required
Apt 19B Room 1	9	Pipe Insulation Inside Vertical Chases	10 LF(visible)	Good/Defer Action/None Required
	11	Floor Tile Martic Associated with 12"x12" White Floor Tiles	750 SF	Good/Defer Action/None Required
Kitchens 103 for Apt 19A & 19B	14	Kitchen Sink Basin Coating	10 SF	Good/Defer Action/None Required
Attics of Apt 19A & 19B	3	Paper Wrap on Galvanized Exhaust Ducts	50 SF	Good/Defer Action/None Required
Exterior	19	Exterior window and door caulk	200 LF	Good/Defer Action/None Required

**APPENDIX B**

**ASBESTOS REPORT FORM**



**Adelaide**  
Environmental Consultants Associates, Inc.

1511 Route 22, Suite C24, Brewster, NY 10509 Tel:845.278.7710 Fax: 845.278.7750 www.adelaideinc.com

## ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

### SERVICES PROVIDED

Asbestos Bulk Sampling						
PESHOGS NO./LAB ID	ID	Sample Location, Coordinates	Material Type	Friable/NonFriable	Homogenous ID	TEM %
NO.		Description and Other Comments				PLM %
/110061660-01	1	Floor A - Apt 19A - Attic insulation paper backing	TSI	Friable	1	NAD
/110061660-02	2	Floor A - Apt 19A - Attic insulation paper backing	TSI	Friable	1	NAD
/110061660-03	3	Floor A - Apt 19A - Attic insulation paper backing	TSI	Friable	1	NAD
/110061660-04	4	Floor A - Apt 19A - Attic insulation (fibrous and wool like)	TSI	Friable	2	NAD
/110061660-05	5	Floor A - Apt 19A - Attic insulation (fibrous and wool like)	TSI	Friable	2	NAD

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

SERVICES PROVIDED			Asbestos Bulk Sampling						
PESHOGS NO. / LAB ID NO.	ID	Sample Location, Coordinates and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
/110061660-06	6	Floor A - Apt 19A - Attic insulation (fibrous and wool like)	TSI	Friable	2		NAD	1500	G
/110061660-07	7	Floor A - Apt 19A - galvanized exhaust duct - paper wrap on duct	Misc.	Friable	3		80% Chrysotile	-	G
/110061660-08	8	Floor A - Apt 19A - galvanized exhaust duct - paper wrap on duct	Misc.	Friable	3		NA/PS		G
/110061660-09	9	Floor 1 - Apt 19A - Kitchen - leftover linoleum backing stuck to wooden floor	Misc.	Friable	4		NAD		SD
/110061660-10	10	Floor 1 - Apt 19A - Kitchen - leftover linoleum backing stuck to wooden floor	Misc.	Friable	4		NAD		SD
/110061660-11	11	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Top coat	Surf.	Friable	5		NAD		D

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## Asbestos Bulk Sampling

SERVICES PROVIDED		ID	Sample Location, Coordinates Description and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
PESHOGS NO. / LAB ID NO.										
/110061660-12	12	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Top coat	Surf.	Friable	5			NAD		D
/110061660-13	13	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Top coat	Surf.	Friable	5			NAD		D
/110061660-14	14	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Base coat	Surf.	Friable	6			NAD		D
/110061660-15	15	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Base coat	Surf.	Friable	6			NAD		D
/110061660-16	16	Floor 1 - Apt 19A - Dining Room - Ceiling Plaster - Base coat	Surf.	Friable	6			NAD		D
/110061660-17	17	Floor 1 - Apt 19A - Wall plaster - Top coat	Surf.	Friable	7			NAD		D
/110061660-18	18	Floor 1 - Apt 19A - Wall plaster - Top coat	Surf.	Friable	7			NAD		G

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## Asbestos Bulk Sampling

SERVICES PROVIDED		Asbestos Bulk Sampling							
PESHOGS NO. / LAB ID NO.	ID	Sample Location, Coordinates	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
/110061660-19	19	Floor 1 - Apt 19A - Wall plaster - Top coat	Surf.	Friable	7		NAD		G
/110061660-20	20	Floor 1 - Apt 19A - Wall plaster - Base coat	Surf.	Friable	8		NAD		G
/110061660-21	21	Floor 1 - Apt 19A - Wall plaster - Base coat	Surf.	Friable	8		NAD		G
/110061660-22	22	Floor 1 - Apt 19A - Wall plaster - Base coat	Surf.	Friable	8		NAD		G
/110061660-23	23	Floor B - Apt 19A - Pipe insulation inside vertical	TSI	Friable	9		14% Chrysotile		G
/110061660-24	24	Floor B - Apt 19A - Pipe insulation inside vertical chases	TSI	Friable	9		NA/PS		G
/110061660-25	25	Floor B - Apt 19A - Pipe insulation inside vertical chases	TSI	Friable	9		NA/PS		G

Misc. - Miscellaneous

Surf. - Surfacing

TSI - Thermal System Insulation

NF - Non-Friable

F - Friable

NA - Not Analyzed by Method

NA/PS - Not Analyzed, Positive Stop

NAD - No Asbestos Detected

Trace/NAD - Non-Astbestos by Definition

SD - Significantly Damaged

D - Damaged

G - Good

UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## Asbestos Bulk Sampling

SERVICES PROVIDED		Asbestos Bulk Sampling							
PESHOGS NO. / LAB ID NO.	ID	Sample Location, Coordinates and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
/110061660-26	26	Floor B - Apt 19A - Basement 12"x12" White Floor tile	Misc.	NonFriable	10		NAD	300 SF	G
/110061660-27	27	Floor B - Apt 19A - Basement - Floor tile mastic associated w/ HA #10	Misc.	NonFriable	11		8% Chrysotile	300 SF	G
/110061660-28	28	Floor B - Apt 19A - Basement - Floor tile mastic associated w/ HA #10	Misc.	NonFriable	11		NA/PS		G
/110061660-29	29	Floor 2 - Apt 19A - Closet 201A - Chase - Tar paper behind tub	Misc.	NonFriable	12		NAD	5 SF	G
/110061660-30	30	Floor 2 - Apt 19A - Closet 201A - Chase - Tar paper behind tub	Misc.	NonFriable	12		NAD		G
/110061660-31	31	Floor 2 - Apt 19B - Ceiling Plaster - Top coat	Surf. Friable		5		NAD		G

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## SERVICES PROVIDED

Asbestos Bulk Sampling			
PESHOGS NO. / LAB ID NO.	ID	Sample Location, Coordinates and Other Comments	Material Type
			Friable / NonFriable
/110061660-32	32	Floor 2 - Apt 19B - Ceiling Plaster - Top coat	Surf. Friable
/110061660-33	33	Floor 2 - Apt 19B - Ceiling Plaster - Base coat	Surf. Friable
/110061660-34	34	Floor 2 - Apt 19B - Ceiling Plaster - Base coat	Surf. Friable
/110061660-35	35	Floor 2 - Apt 19B - Wall Plaster - Top coat	Surf. Friable
/110061660-36	36	Floor 2 - Apt 19B - Wall Plaster - Top coat	Surf. Friable
/110061660-37	37	Floor 2 - Apt 19B - Wall Plaster - Top coat	Surf. Friable
/110061660-38	38	Floor 2 - Apt 19B - Wall Plaster - Base coat	Surf. Friable

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## SERVICES PROVIDED

Asbestos Bulk Sampling						
PESHOGS NO. / LAB ID NO.	ID	Sample Location, Coordinates Description and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %
/110061660-39	39	Floor 2 - Apt 19B - Wall Plaster - Base coat	Surf.	Friable	8	NAD
/110061660-40	40	Floor 2 - Apt 19B - Wall Plaster - Base coat	Surf.	Friable	8	NAD
/110061660-41	41	Floor A - Apt 19B - Millboard covering the attic insulation	Misc.	Friable	13	NAD
/110061660-42	42	Floor A - Apt 19B - Millboard covering the attic insulation	Misc.	Friable	13	NAD
/110061660-43	43	Floor 1 - Apt 19B - Kitchen sink basin coating (black)	Misc.	NonFriable	14	6% Chrysotile
/110061660-44	44	Floor 1 - Apt 19B - Kitchen sink basin coating (black)	Misc.	NonFriable	14	NA/PS
/110061660-45	45	Floor 1 - Apt 19B - Entry - closet door panels	Misc.	NonFriable	15	NAD

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## Asbestos Bulk Sampling

SERVICES PROVIDED		ID	Sample Location, Coordinates Description and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
PESHOGS NO. / LAB ID NO.		/110061660-46	Floor 1 - Apt 19B - Entry - closet door panels	Misc.	NonFriable	15		NAD		G
/110061660-47		47	Floor 1 - Apt 19B - Entry - Brown linoleum backing	Misc.	Friable	16		NAD		D
/110061660-48		48	Floor 1 - Apt 19B - Entry - Brown linoleum backing	Misc.	Friable	16		NAD		D
/110061660-49		49	Floor 1 - Apt 19B - Kitchen - tan linoleum backing	Misc.	Friable	17		NAD		D
/110061660-50		50	Floor 1 - Apt 19B - Kitchen - tan linoleum backing	Misc.	Friable	17		NAD		D
/110061660-51		51	Floor G - Exterior - window glazing compound	Misc.	NonFriable	18		NAD		G
/110061660-52		52	Floor G - Exterior - Door caulk	Misc.	NonFriable	19		NAD		G

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

# ASBESTOS REPORT FORM

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED: 6/23/2010  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber, Tom Ferro

## Asbestos Bulk Sampling

SERVICES PROVIDED		ID	Sample Location, Coordinates Description and Other Comments	Material Type	Friable/ NonFriable	Homogenous ID	TEM %	PLM %	Quantity	Assess Cat.
/110061660-53		53	Floor G - Exterior - Door caulk	Misc.	NonFriable	19		7%		G
/110061660-54		54	Floor G - Exterior - Brick Mortar	Misc.	Friable	20		NAD		G
/110061660-55		55	Floor G - Exterior - Brick Mortar	Misc.	Friable	20		NAD		G
/110061660-56		56	Floor G - Exterior - Stone Mortar	Misc.	Friable	21		NAD		G
/110061660-57		57	Floor G - Exterior - Stone Mortar	Misc.	Friable	21		NAD		G

Misc. - Miscellaneous  
Surf. - Surfacing  
TSI - Thermal System Insulation  
NF - Non-Friable  
F - Friable

NA - Not Analyzed by Method  
NA/PS - Not Analyzed, Positive Stop  
NAD - No Asbestos Detected  
Trace/NAD - Non-Asbestos by Definition  
SD - Significantly Damaged  
D - Damaged  
G - Good  
UK - Unknown

**APPENDIX C**

**ASBESTOS ANALYTICAL RESULTS**

**AND CHAIN OF CUSTODY FORM**

**PLM Bulk Asbestos Report**

Adelaide Environmental Health  
 Attn: John Soter  
 1454 Rte. 22 Suite B202  
 Brewster, NY 10509

Date Received 06/22/10 AmeriSci Job # 110061660  
 Date Examined 06/23/10 P.O. #  
 Page 1 of 10  
**RE:** VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
 1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
1	110061660-01	No	NAD
1	Location: Apt 19A - Attic Insulation Paper Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 98 %, Non-fibrous 2 %			
2	110061660-02	No	NAD
1	Location: Apt 19A - Attic Insulation Paper Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 98 %, Non-fibrous 2 %			
3	110061660-03	No	NAD
1	Location: Apt 19A - Attic Insulation Paper Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 98 %, Non-fibrous 2 %			
4	110061660-04	No	NAD
2	Location: Apt 19A - Attic Insulation (Fibrous and Wool Like)		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Fibrous glass 95 %, Non-fibrous 5 %			
5	110061660-05	No	NAD
2	Location: Apt 19A - Attic Insulation (Fibrous and Wool Like)		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Fibrous glass 95 %, Non-fibrous 5 %			

Client Name: Adelaide Environmental Health

## PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
6	110061660-06	No	NAD
2	Location: Apt 19A - Attic Insulation (Fibrous and Wool Like)		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Fibrous glass 95 %, Non-fibrous 5 %			
7	110061660-07	Yes	80 %
3	Location: Apt 19A - Galvanized Exhaust Duct - Paper Wrap On Duct		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Lt. Gray, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b> Chrysotile 80.0 %			
<b>Other Material:</b> Non-fibrous 20 %			
8	110061660-08		NA/PS
3	Location: Apt 19A - Galvanized Exhaust Duct - Paper Wrap On Duct		
<b>Analyst Description:</b> Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b>			
9	110061660-09	No	NAD
4	Location: Apt 19A - Kitchen - Leftover Linoleum Backing Stuck To Wooden Floor		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Tan, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 95 %, Non-fibrous 5 %			
10	110061660-10	No	NAD
4	Location: Apt 19A - Kitchen - Leftover Linoleum Backing Stuck To Wooden Floor		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Tan, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 95 %, Non-fibrous 5 %			
11	110061660-11	No	NAD
5	Location: Apt 19A - Dining Room - Ceiling Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			

# PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
12	110061660-12	No	NAD
5	Location: Apt 19A - Dining Room - Ceiling Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
13	110061660-13	No	NAD
5	Location: Apt 19A - Dining Room - Ceiling Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
14	110061660-14	No	NAD
6	Location: Apt 19A - Dining Room - Ceiling Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
15	110061660-15	No	NAD
6	Location: Apt 19A - Dining Room - Ceiling Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
16	110061660-16	No	NAD
6	Location: Apt 19A - Dining Room - Ceiling Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
17	110061660-17	No	NAD
7	Location: Apt 19A - Wall Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			

Client Name: Adelaide Environmental Health

## PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
18	110061660-18	No	NAD
7	Location: Apt 19A - Wall Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
19	110061660-19	No	NAD
7	Location: Apt 19A - Wall Plaster - Top Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
20	110061660-20	No	NAD
8	Location: Apt 19A - Wall Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
21	110061660-21	No	NAD
8	Location: Apt 19A - Wall Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
22	110061660-22	No	NAD
8	Location: Apt 19A - Wall Plaster - Base Coat		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
23	110061660-23	Yes	14 %
9	Location: Apt 19A - Pipe Insulation Inside Vertical Chases		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b> Crocidolite 4.0 %, Chrysotile 10.0 %			
<b>Other Material:</b> Non-fibrous 86 %			

# **PLM Bulk Asbestos Report**

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
24	110061660-24		NA/PS
9	Location: Apt 19A - Pipe Insulation Inside Vertical Chases		
	<b>Analyst Description:</b> Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b>		
25	110061660-25		NA/PS
9	Location: Apt 19A - Pipe Insulation Inside Vertical Chases		
	<b>Analyst Description:</b> Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b>		
26	110061660-26	No	NAD
10	Location: Apt 19A - Basement 12"x12" White Floor Tile		(by CVES) by William M. Dunstan on 06/23/10
	<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		
27	110061660-27	Yes	8 %
11	Location: Apt 19A - Basement - Floor Tile Mastic Associated w/HA #10		(by CVES) by William M. Dunstan on 06/23/10
	<b>Analyst Description:</b> Black, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> Chrysotile 8.0 % <b>Other Material:</b> Non-fibrous 92 %		
28	110061660-28		NA/PS
11	Location: Apt 19A - Basement - Floor Tile Mastic Associated w/HA #10		
	<b>Analyst Description:</b> Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b>		
29	110061660-29	No	NAD
12	Location: Apt 19A - Closet 201A - Chase - Tar Paper Behind Tub		(by CVES) by William M. Dunstan on 06/23/10
	<b>Analyst Description:</b> Black, Heterogeneous, Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose 50 %, Non-fibrous 50 %		

Client Name: Adelaide Environmental Health

# PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
30	110061660-30	No	NAD
12	Location: Apt 19A - Closet 201A - Chase - Tar Paper Behind Tub	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> Black, Heterogeneous, Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose 50 %, Non-fibrous 50 %		
31	110061660-31	No	NAD
5	Location: Apt 19B - Ceiling Plaster - Top Coat	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		
32	110061660-32	No	NAD
5	Location: Apt 19B - Ceiling Plaster - Top Coat	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		
33	110061660-33	No	NAD
6	Location: Apt 19B - Ceiling Plaster - Base Coat	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		
34	110061660-34	No	NAD
6	Location: Apt 19B - Ceiling Plaster - Base Coat	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		
35	110061660-35	No	NAD
7	Location: Apt 19B - Wall Plaster - Top Coat	(by CVES) by William M. Dunstan on 06/23/10	
	<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %		

## PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
36 7	110061660-36 <b>Location:</b> Apt 19B - Wall Plaster - Top Coat	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %			
37 7	110061660-37 <b>Location:</b> Apt 19B - Wall Plaster - Top Coat	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> White, Heterogeneous, Non-Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Non-fibrous 100 %			
38 8	110061660-38 <b>Location:</b> Apt 19B - Wall Plaster - Base Coat	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
39 8	110061660-39 <b>Location:</b> Apt 19B - Wall Plaster - Base Coat	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
40 8	110061660-40 <b>Location:</b> Apt 19B - Wall Plaster - Base Coat	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose Trace, Non-fibrous 100 %			
41 13	110061660-41 <b>Location:</b> Apt 19B - Millboard Covering The Attic Insulation	<b>No</b>	NAD (by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Fibrous, Bulk Material <b>Asbestos Types:</b> <b>Other Material:</b> Cellulose 95 %, Non-fibrous 5 %			

Client Name: Adelaide Environmental Health

## PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
42	110061660-42	No	NAD
13	Location: Apt 19B - Millboard Covering The Attic Insulation		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 95 %, Non-fibrous 5 %			
43	110061660-43	Yes	6 %
14	Location: Apt 19B - Kitchen Sink Basin Coating (Black)		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Black, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b> Chrysotile 6.0 %			
<b>Other Material:</b> Non-fibrous 94 %			
44	110061660-44		NA/PS
14	Location: Apt 19B - Kitchen Sink Basin Coating (Black)		
<b>Analyst Description:</b> Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b>			
45	110061660-45	No	NAD
15	Location: Apt 19B - Entry - Closet Door Panels		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 92 %, Non-fibrous 8 %			
46	110061660-46	No	NAD
15	Location: Apt 19B - Entry - Closet Door Panels		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Brown, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 92 %, Non-fibrous 8 %			
47	110061660-47	No	NAD
16	Location: Apt 19B - Entry - Brown Linoleum Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Synthetic fibers 15 %, Non-fibrous 85 %			

Client Name: Adelaide Environmental Health

# PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
48	110061660-48	No	NAD
16	<b>Location:</b> Apt 19B - Entry - Brown Linoleum Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Synthetic fibers 15 %, Non-fibrous 85 %			
49	110061660-49	No	NAD
17	<b>Location:</b> Apt 19B - Kitchen - Tan Linoleum Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 35 %, Fibrous glass 10 %, Non-fibrous 55 %			
50	110061660-50	No	NAD
17	<b>Location:</b> Apt 19B - Kitchen - Tan Linoleum Backing		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Cellulose 35 %, Fibrous glass 10 %, Non-fibrous 55 %			
51	110061660-51	No	NAD
18	<b>Location:</b> Exterior - Window Glazing Compound		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
52	110061660-52	No	NAD
19	<b>Location:</b> Exterior - Door Caulk		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Fibrous Talc Trace, Non-fibrous 100 %			
53	110061660-53	Yes	7 %
19	<b>Location:</b> Exterior - Door Caulk		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Bulk Material			
<b>Asbestos Types:</b> Chrysotile 7.0 %			
<b>Other Material:</b> Non-fibrous 93 %			

Client Name: Adelaide Environmental Health

# PLM Bulk Asbestos Report

VAMC:10079.00-IN; Salem VA Medical Center; Building 19;  
1970 Roanoke Blvd, Salem, Virginia 24153

<b>Client No. / HGA</b>	<b>Lab No.</b>	<b>Asbestos Present</b>	<b>Total % Asbestos</b>
54	110061660-54	No	NAD
20	Location: Exterior - Brick Mortar		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
55	110061660-55	No	NAD
20	Location: Exterior - Brick Mortar		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Beige, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
56	110061660-56	No	NAD
21	Location: Exterior - Stone Mortar		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			
57	110061660-57	No	NAD
21	Location: Exterior - Stone Mortar		(by CVES) by William M. Dunstan on 06/23/10
<b>Analyst Description:</b> Gray, Heterogeneous, Non-Fibrous, Cementitious, Bulk Material			
<b>Asbestos Types:</b>			
<b>Other Material:</b> Non-fibrous 100 %			

**Reporting Notes:**

Analyzed by: William M. Dunstan William M. Dunstan Date 6/23/10  
 \*NAD = no asbestos detected, Detection Limit <1%, Reporting Limits: CVES = 1%, 400 Pt Ct = 0.25%, 1000 Pt Ct = 0.1%; "Present" or NVA = "No Visible Asbestos" are observations made during a qualitative analysis; NA = not analyzed; NAPS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab Code 101904-0) and ELAP PLM Analysis Protocol 198.1 for New York friable samples (198.6 for NOB samples)(NYSDOH ELAP Lab # 10984); CA ELAP Lab # 2508; Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar NOB materials. NAD or Trace results by PLM are inconclusive, TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). NIST Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested.

Reviewed By: TBH



1511 Route 22, Suite C24, Brewster, NY 10509

Tel:845.278.7710 Fax: 845.278.7750 www.adelaideinc.com

## Chain of Custody

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION:Salem VA Medical Center - Building 19  
1970 Roanoke Blvd

Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED:  
TOTAL SAMPLE COUNT: 57

SAMPLE COLLECTOR(S): James Reber and Tom Ferro

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK:
1	A	1	Apt 19A - Attic insulation paper backing	1500	Friable	G
2	A	1	Apt 19A - Attic insulation paper backing	1500	Friable	G
3	A	1	Apt 19A - Attic insulation paper backing	1500	Friable	G
4	A	2	Apt 19A - Attic insulation (fibrous and wool like)	1500	Friable	G
5	A	2	Apt 19A - Attic insulation (fibrous and wool like)	1500	Friable	G
6	A	2	Apt 19A - Attic insulation (fibrous and wool like)	1500	Friable	G
7	A	3	Apt 19A - galvanized exhaust duct - paper wrap on duct	-	Friable	G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

Special Instructions/ Turnaround Time:

Relinquished by:

Page 1 of 7

Analyze all samples by PLM only

Stop at 1st Positive per Homogenous Area

72 hr TAT

Fax Results to 845-278-7750

E-Mail Results to AdelaileLabResults@adelaideinc.com

Received by:

Relinquished by:

DECEIVE
JUN 22 2010
By

## Chain of Custody

**PROJECT NUMBER:** VAMC:10079.00-IN

**PROJECT LOCATION:** Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010  
DATE REPORTED:  
TOTAL SAMPLE COUNT: 57

SAMPLE COLLECTOR(S): James Reber and Tom Ferro

Sample ID#	Floor	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK
8	A	3	Apt 19A - galvanized exhaust duct - paper wrap on duct		Friable	G
9	1	4	Apt 19A - Kitchen - leftover linoleum backing stuck to wooden floor		Friable	SD
10	1	4	Apt 19A - Kitchen - leftover linoleum backing stuck to wooden floor		Friable	SD
11	1	5	Apt 19A - Dining Room - Ceiling Plaster - Top coat		Friable	D
12	1	5	Apt 19A - Dining Room - Ceiling Plaster - Top coat		Friable	D
13	1	5	Apt 19A - Dining Room - Ceiling Plaster - Top coat		Friable	D
14	1	6	Apt 19A - Dining Room - Ceiling Plaster - Base coat		Friable	D
15	1	6	Apt 19A - Dining Room - Ceiling Plaster - Base coat		Friable	D
16	1	6	Apt 19A - Dining Room - Ceiling Plaster - Base coat		Friable	D

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

**Special Instructions/ Turnaround Time:**

Relinquished by:



Page 2 of 7

**Analyze all samples by PLM only**

**Stop at 1st Positive per Homogenous Area**


**72 hr TAT**

**Fax Results to 845-278-7750**

**E-Mail Results to AdelaideLabResults@adelaidelab.com**

Received by:

Relinquished by:

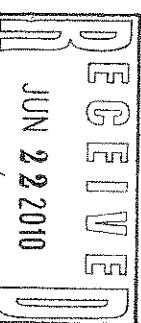

Received by:

By:

SV

## Chain of Custody

**PROJECT NUMBER:** VAMC:10079.00-IN

**PROJECT LOCATION:** Salem VA Medical Center - Building 19

1970 Roanoke Blvd

Salem, Virginia 24153

**DATE RECEIVED:** 6/7/2010  
**DATE COMPLETED:** 6/18/2010  
**DATE REPORTED:**  
**TOTAL SAMPLE COUNT:** 57  
**SAMPLE COLLECTOR(S):** James Reber and Tom Ferro

**110061660**

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK:
17	1	7	Apt 19A - Wall plaster - Top coat		Friable	G
18	1	7	Apt 19A - Wall plaster - Top coat		Friable	G
19	1	7	Apt 19A - Wall plaster - Top coat		Friable	G
20	1	8	Apt 19A - Wall plaster - Base coat		Friable	G
21	1	8	Apt 19A - Wall plaster - Base coat		Friable	G
22	1	8	Apt 19A - Wall plaster - Base coat		Friable	G
23	B	9	Apt 19A - Pipe insulation inside vertical chases		Friable	G
24	B	9	Apt 19A - Pipe insulation inside vertical chases		Friable	G
25	B	9	Apt 19A - Pipe insulation inside vertical chases		Friable	G
26	B	10	Apt 19A - Basement 12"x12" White Floor tile	300 SF	NonFriable	G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

**Special Instructions/ Turnaround Time:**

**Analyze all samples by PLM only**

**Stop at 1st Positive per Homogenous Area**


**72 hr TAT**

**Fax Results to 845-278-7750**

**E-Mail Results to AdelaideLabResults@adelaideLLC.com**

Received by: *Joyce M*

Page 3 of 7

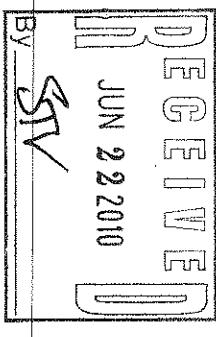

# Chain of Custody

110061660

PROJECT NUMBER: VAMC:10079.00-IN

DATE RECEIVED: 6/7/2010  
DATE COMPLETED: 6/18/2010

PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

DATE REPORTED:  
TOTAL SAMPLE COUNT: 57  
SAMPLE COLLECTOR(S): James Reber and Tom Ferro

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK
27	B	11	Apt 19A - Basement - Floor tile mastic associated w/ HA #10	300 SF	NonFriable	G
28	B	11	Apt 19A - Basement - Floor tile mastic associated w/ HA #10	300 SF	NonFriable	G
29	2	12	Apt 19A - Basement - Floor tile mastic associated w/ HA #10	300 SF	NonFriable	G
30	2	12	Apt 19A - Closet 201A - Chase - Tar paper behind tub	5 SF	NonFriable	G
31	2	5	Apt 19A - Closet 201A - Chase - Tar paper behind tub	5 SF	NonFriable	G
32	2	5	Apt 19B - Ceiling Plaster - Top coat	300 SF	Friable	G
33	2	6	Apt 19B - Ceiling Plaster - Top coat	300 SF	Friable	G
34	2	6	Apt 19B - Ceiling Plaster - Base coat	300 SF	Friable	G
35	2	7	Apt 19B - Wall Plaster - Base coat	300 SF	Friable	G
36	2	7	Apt 19B - Wall Plaster - Top coat	300 SF	Friable	G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

Special Instructions/ Turnaround Time:

Received by:

*Joyce M*

Page 4 of 7

Analyze all samples by PLM only

Stop at 1st Positive per Homogenous Area


72 hr TAT

Fax Results to 845-278-7750

E-Mail Results to AdelaideLabResults@adelaidellc.com

Received by:

*SAR*

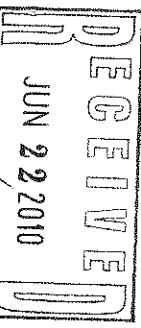

# Chain of Custody

110061660

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION:Salem VA Medical Center - Building 19

1970 Roanoke Blvd

Salem, Virginia 24153

DATE RECIEVED: 6/7/2010  
DATE COMPLETED: 6/18/2010

DATE REPORTED:

TOTAL SAMPLE COUNT: 57

SAMPLE COLLECTOR(S): James Reber and Tom Ferro

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK
37	2	7	Apt 19B - Wall Plaster - Top coat		Friable	G
38	2	8	Apt 19B - Wall Plaster - Base coat		Friable	G
39	2	8	Apt 19B - Wall Plaster - Base coat		Friable	G
40	2	8	Apt 19B - Wall Plaster - Base coat		Friable	G
41	A	13	Apt 19B - Millboard covering the attic insulation		Friable	G
42	A	13	Apt 19B - Millboard covering the attic insulation		Friable	G
43	1	14	Apt 19B - Kitchen sink basin coating (black)		NonFriable	G
44	1	14	Apt 19B - Kitchen sink basin coating (black)		NonFriable	G
45	1	15	Apt 19B - Entry - closet door panels		NonFriable	G
46	1	15	Apt 19B - Entry - closet door panels		NonFriable	G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

Special Instructions/ Turnaround Time:

Analyze all samples by PLM only  
Stop at 1st Positive per Homogenous Area  
Fax Results to 845-278-7750  
E-Mail Results to AdelaLabResults@adelaidelc.com

Received by:  
*Joyce*

Relinquished by:  
*Joyce*

Page 5 of 7

DECEIVED
JUN 22 2010

# Chain of Custody

110061660

PROJECT NUMBER: VAMC:10079.00-IN

PROJECT LOCATION:Salem VA Medical Center - Building 19

1970 Roanoke Blvd

Salem, Virginia 24153

DATE RECIEVED: 6/7/2010  
DATE COMPLETED: 6/18/2010

DATE REPORTED:

TOTAL SAMPLE COUNT: 57

SAMPLE COLLECTOR(S): James Reber and Tom Ferro

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable NonFriable	Condition SD, D, G, UK
47	1	16	Apt 19B - Entry - Brown linoleum backing		Friable	D
48	1	16	Apt 19B - Entry - Brown linoleum backing		Friable	D
49	1	17	Apt 19B - Kitchen - tan linoleum backing		Friable	D
50	1	17	Apt 19B - Kitchen - tan linoleum backing		Friable	D
51	G	18	Exterior - window glazing compound		NonFriable	G
52	G	19	Exterior - Door caulk		NonFriable	G
53	G	19	Exterior - Door caulk		NonFriable	G
54	G	20	Exterior - Brick Mortar		Friable	G
55	G	20	Exterior - Brick Mortar		Friable	G
56	G	21	Exterior - Stone Mortar		Friable	G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

Special Instructions/ Turnaround Time:

Relinquished by: *Jayne*

Received by:

Relinquished by:



Page 6 of 7

Analyze all samples by PLM only

Stop at 1st Positive per Homogenous Area

72 hr TAT

Fax Results to 845-278-7750

E-Mail Results to AdelaideLabResults@adelaidellc.com

# Chain of Custody

110061660

DATE RECEIVED: 6/7/2010

DATE COMPLETED: 6/18/2010

DATE REPORTED:

TOTAL SAMPLE COUNT: 57

SAMPLE COLLECTOR(S): James Reber and Tom Ferro

PROJECT NUMBER: VAMC:10079.00-IN  
PROJECT LOCATION: Salem VA Medical Center - Building 19  
1970 Roanoke Blvd  
Salem, Virginia 24153

Sample ID#	Floor Level	Homogenous Area	Sample Location/Description	Quantity (in feet)	Friable	NonFriable	Condition SD, D, G, UK:
57	G	21	Exterior - Stone Mortar		Friable		G

SD - Significantly Damaged | D - Damaged | G - Good | UK - Unknown

Special Instructions/ Turnaround Time:

Relinquished by:

Page 7 of 7

Received by:

Relinquished by:

DEGEEIVE  
JUN 22 2010

Received by:

By SW

Analyze all samples by PLM only

Stop at 1st Positive per Homogenous Area

72 hr TAT

Fax Results to 845-278-7750

E-Mail Results to AdelaideLabResults@adelaidelc.com

**APPENDIX D**

**SAMPLE LOCATION MAP**

**AND PHOTOS**




**Paper Wrap on Duct in Attics - 80% Chrysotile**




**Pipe Insulation inside vertical chases – 4% Crocidolite and 10% Chrysotile (14% Total asbestos)**



**Floor Tile mastic associated with 12"x12" white floor tiles – 8% Chrysotile**

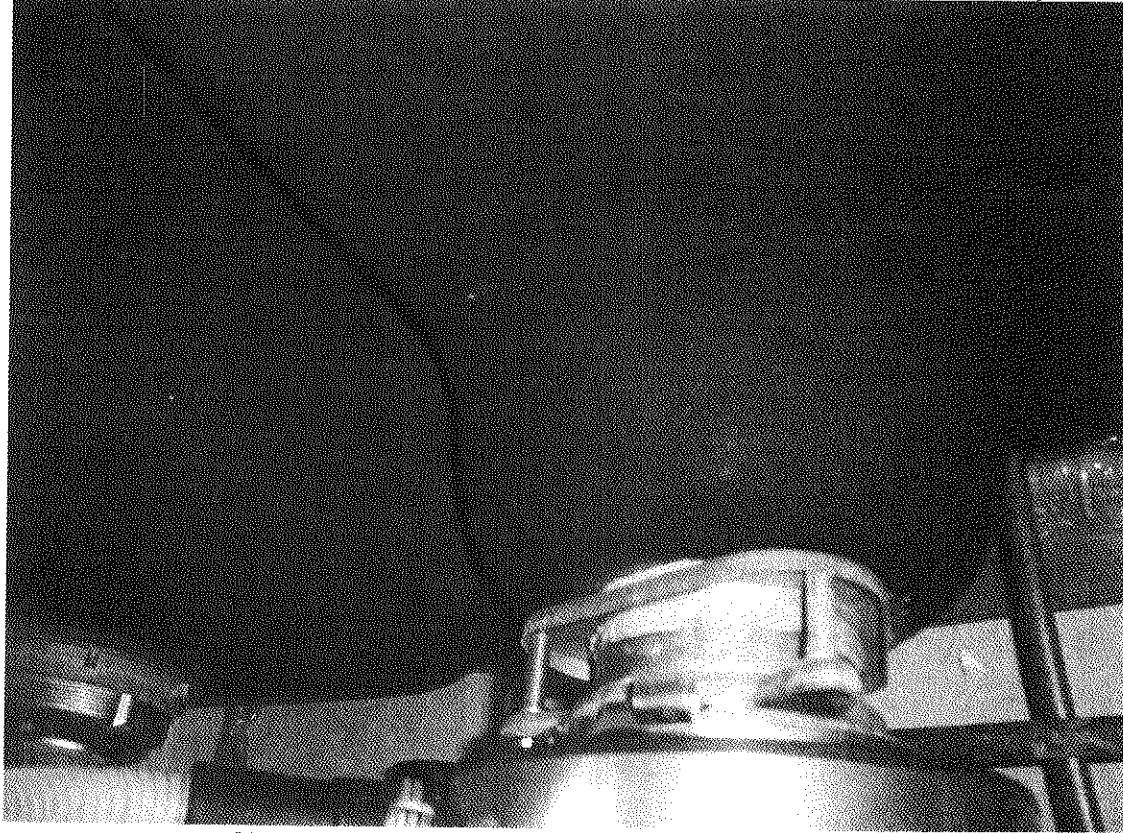

**Kitchen sink basin coating – 6% Chrysotile**

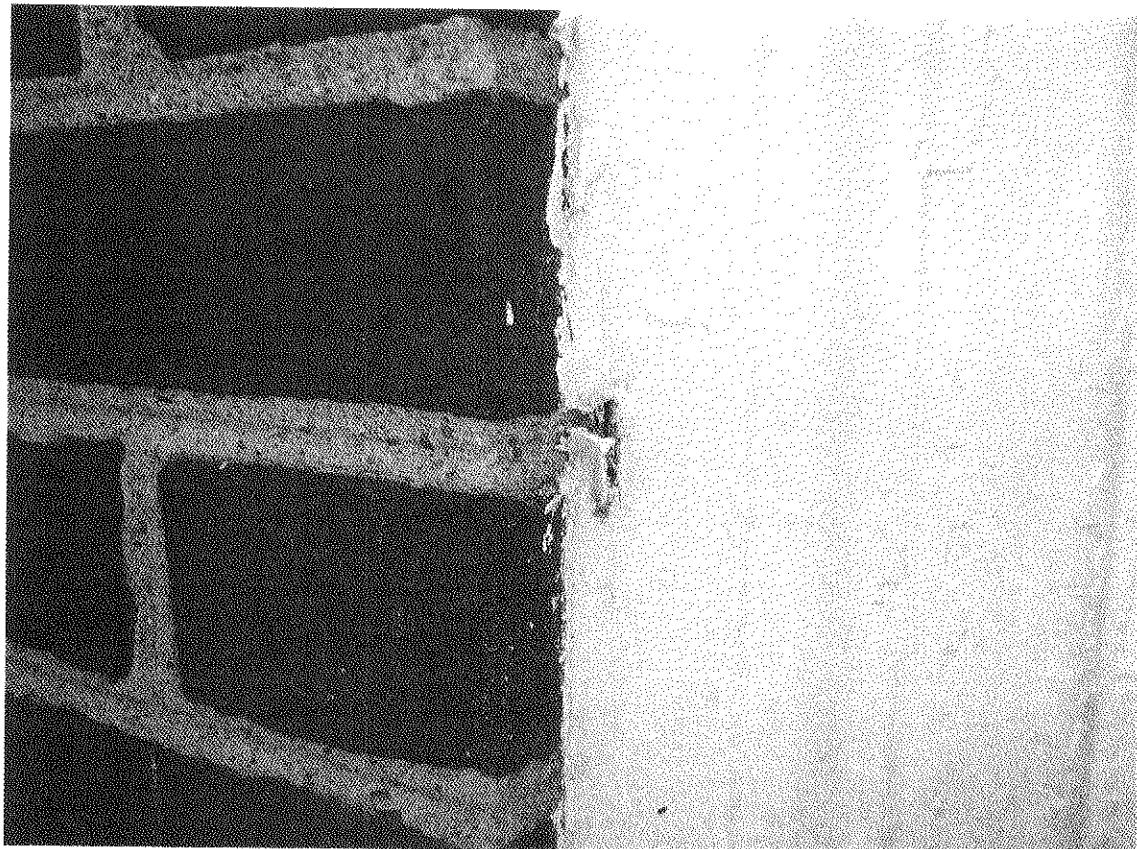

**Exterior Door Caulk (window caulk is homogenous) – 7% Chrysotile**

**APPENDIX E**

**PERSONNEL AND LABORATORY**

**CERTIFICATIONS**

NEW YORK STATE - DEPARTMENT OF LABOR

DIVISION OF SAFETY AND HEALTH  
LICENSE AND CERTIFICATE UNIT  
STATE CAMPUS BUILDING 12  
ALBANY, NY 12240

ASBESTOS HANDLING LICENSE

Adelaide Environmental Health Associates, Inc.  
Suite C22  
1511 Route 22

Brewster, NY 10509

FILE NUMBER: 99-0656  
LICENSE NUMBER: 29305  
LICENSE CLASS: RESTRICTED  
DATE OF ISSUE: 06/10/2010  
EXPIRATION DATE: 07/31/2011

Duly Authorized Representative – John Soter

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.

*Maureen A. Cox*

Maureen A. Cox, Director  
FOR THE COMMISSIONER OF LABOR

DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION  
COMMONWEALTH OF VIRGINIA

EXPIRES ON  
**03-31-2011**

9960 Mayland Dr., Suite 400, Richmond, VA 23233  
Telephone: (804) 367-8500

NUMBER  
**3333 000266**

VIRGINIA ASBESTOS LICENSE  
ASBESTOS ANALYTICAL LABORATORY LICENSE

AMERICA SCIENCE TEAM RICHMOND, INC  
13635 GENITO ROAD

MIDLOTHIAN, VA 23112

PCM  
PLM  
TEM



*Jay W. DeBoer*  
Jay W. DeBoer, Director

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER THAN THOSE NAMED MAY RESULT IN CRIMINAL PROSECUTION UNDER THE CODE OF VIRGINIA.

(SEE REVERSE SIDE FOR NAME AND/OR ADDRESS CHANGE)

(POCKET CARD)

COMMONWEALTH OF VIRGINIA

VIRGINIA ASBESTOS LICENSE

ASBESTOS ANALYTICAL LABORATORY

NUMBER: 3333 000266 EXPIRES: 03-31-2011

PCM PLM TEM

AMERICA SCIENCE TEAM RICHMOND, INC  
13635 GENITO ROAD

MIDLOTHIAN VA 23112

(DETACH HERE)  
DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION  
9960 Mayland Dr., Suite 400, Richmond, VA 23233

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER THAN THOSE NAMED MAY RESULT IN CRIMINAL PROSECUTION UNDER THE CODE OF VIRGINIA.

**DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION  
COMMONWEALTH OF VIRGINIA**

EXPIRES ON  
**04-30-2011**

9960 Mayland Dr., Suite 400, Richmond, VA 23233  
Telephone: (804) 367-8500

NUMBER  
**3303 003537**

**VIRGINIA ASBESTOS LICENSE  
INSPECTOR LICENSE**

**THOMAS P FERRO**

**PO BOX 35  
HALSTEAD, PA 19922**



*Jay W. DeBoer*  
Jay W. DeBoer, Director

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER  
THAN THOSE NAMED MAY RESULT IN CRIMINAL PROSECUTION UNDER THE CODE OF VIRGINIA.

(SEE REVERSE SIDE FOR NAME AND/OR ADDRESS CHANGE)

(POCKET CARD)

COMMONWEALTH OF VIRGINIA  
VIRGINIA ASBESTOS LICENSE  
INSPECTOR LICENSE

NUMBER: 3303 003531 EXPIRES 12-31-2010

JAMES J REBER  
33A OSPREY LN

GARDINER NY 12525

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER



(POCKET CARD)

COMMONWEALTH OF VIRGINIA  
VIRGINIA ASBESTOS LICENSE  
MANAGEMENT PLANNER LICENSE

NUMBER: 3304 001577 EXPIRE 05-31-2011

JOHN W SOTER  
22 JOSH LANE

DANBURY CT 06811



ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER THAN THE LICENSEE IS ILLEGAL.

**DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION  
COMMONWEALTH OF VIRGINIA**

EXPIRES ON

06-30-2011

NUMBER


3303 003575

9860 Mayland Dr., Suite 400, Richmond, VA 23233  
Telephone: (804) 367-8500

**VIRGINIA ASBESTOS LICENSE  
INSPECTOR LICENSE**

ROBERT A SEE  
15 BOYCE ST

BEACON, NY 12508

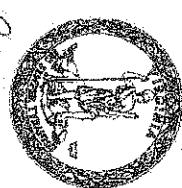

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER THAN THOSE NAMED MAY RESULT IN CRIMINAL PROSECUTION UNDER THE CODE OF VIRGINIA.

(SEE REVERSE SIDE FOR NAME AND/OR ADDRESS CHANGE)

(POCKET CARD)

COMMONWEALTH OF VIRGINIA,

VIRGINIA ASBESTOS LICENSE  
INSPECTOR LICENSE

(DETACH HERE)  
DEPARTMENT OF PROFESSIONAL AND OCCUPATIONAL REGULATION

9860 Mayland Dr., Suite 400, Richmond, VA 23233

NUMBER: 3303 003575 EXPIRES: 06-30-2011

ROBERT A SEE  
15 BOYCE ST

BEACON NY 12508

ALTERATION OF THIS DOCUMENT, USE AFTER EXPIRATION, OR USE BY PERSONS OR FIRMS OTHER THAN THOSE NAMED MAY RESULT IN CRIMINAL PROSECUTION UNDER THE CODE OF VIRGINIA.

(B-68)