

Revisions:	Date

**CONSTRUCTION DOCUMENTS**  
**FULLY SPRINKLERED**



8055 E. Tulare Avenue, Suite 1100  
 Denver, Colorado 80237  
 P: (303) 779-1222  
 F: (303) 779-1224  
 WWW.SSR-INC.COM  
 SSR JOB #: 12530330

**EFT ARCHITECTS**



265 EAST 100 SOUTH SUITE 350  
 SALT LAKE CITY, UTAH 84111-1604  
 801.521.8564 WWW.EFTARCH.COM

**DEPARTMENT OF VETERANS AFFAIRS**  
**MEDICAL CENTER**  
 1056 Clemons Street  
 Denver, Colorado, 80220

**Partial Title**  
 PARTIAL BASEMENT ELECTRICAL PLAN - SPS

**Approved: Project Director**

**Project Title**  
 SPS PIPING AND EQUIPMENT SITE PREP

**Location**  
 DENVER VA MEDICAL CENTER

**Date**  
 12 FEB. 2013

**Checked**  
 GEV

**Drawn**  
 TAH

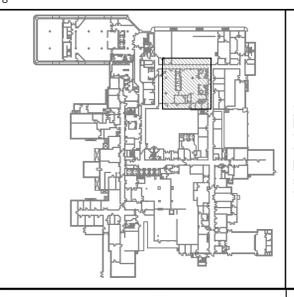
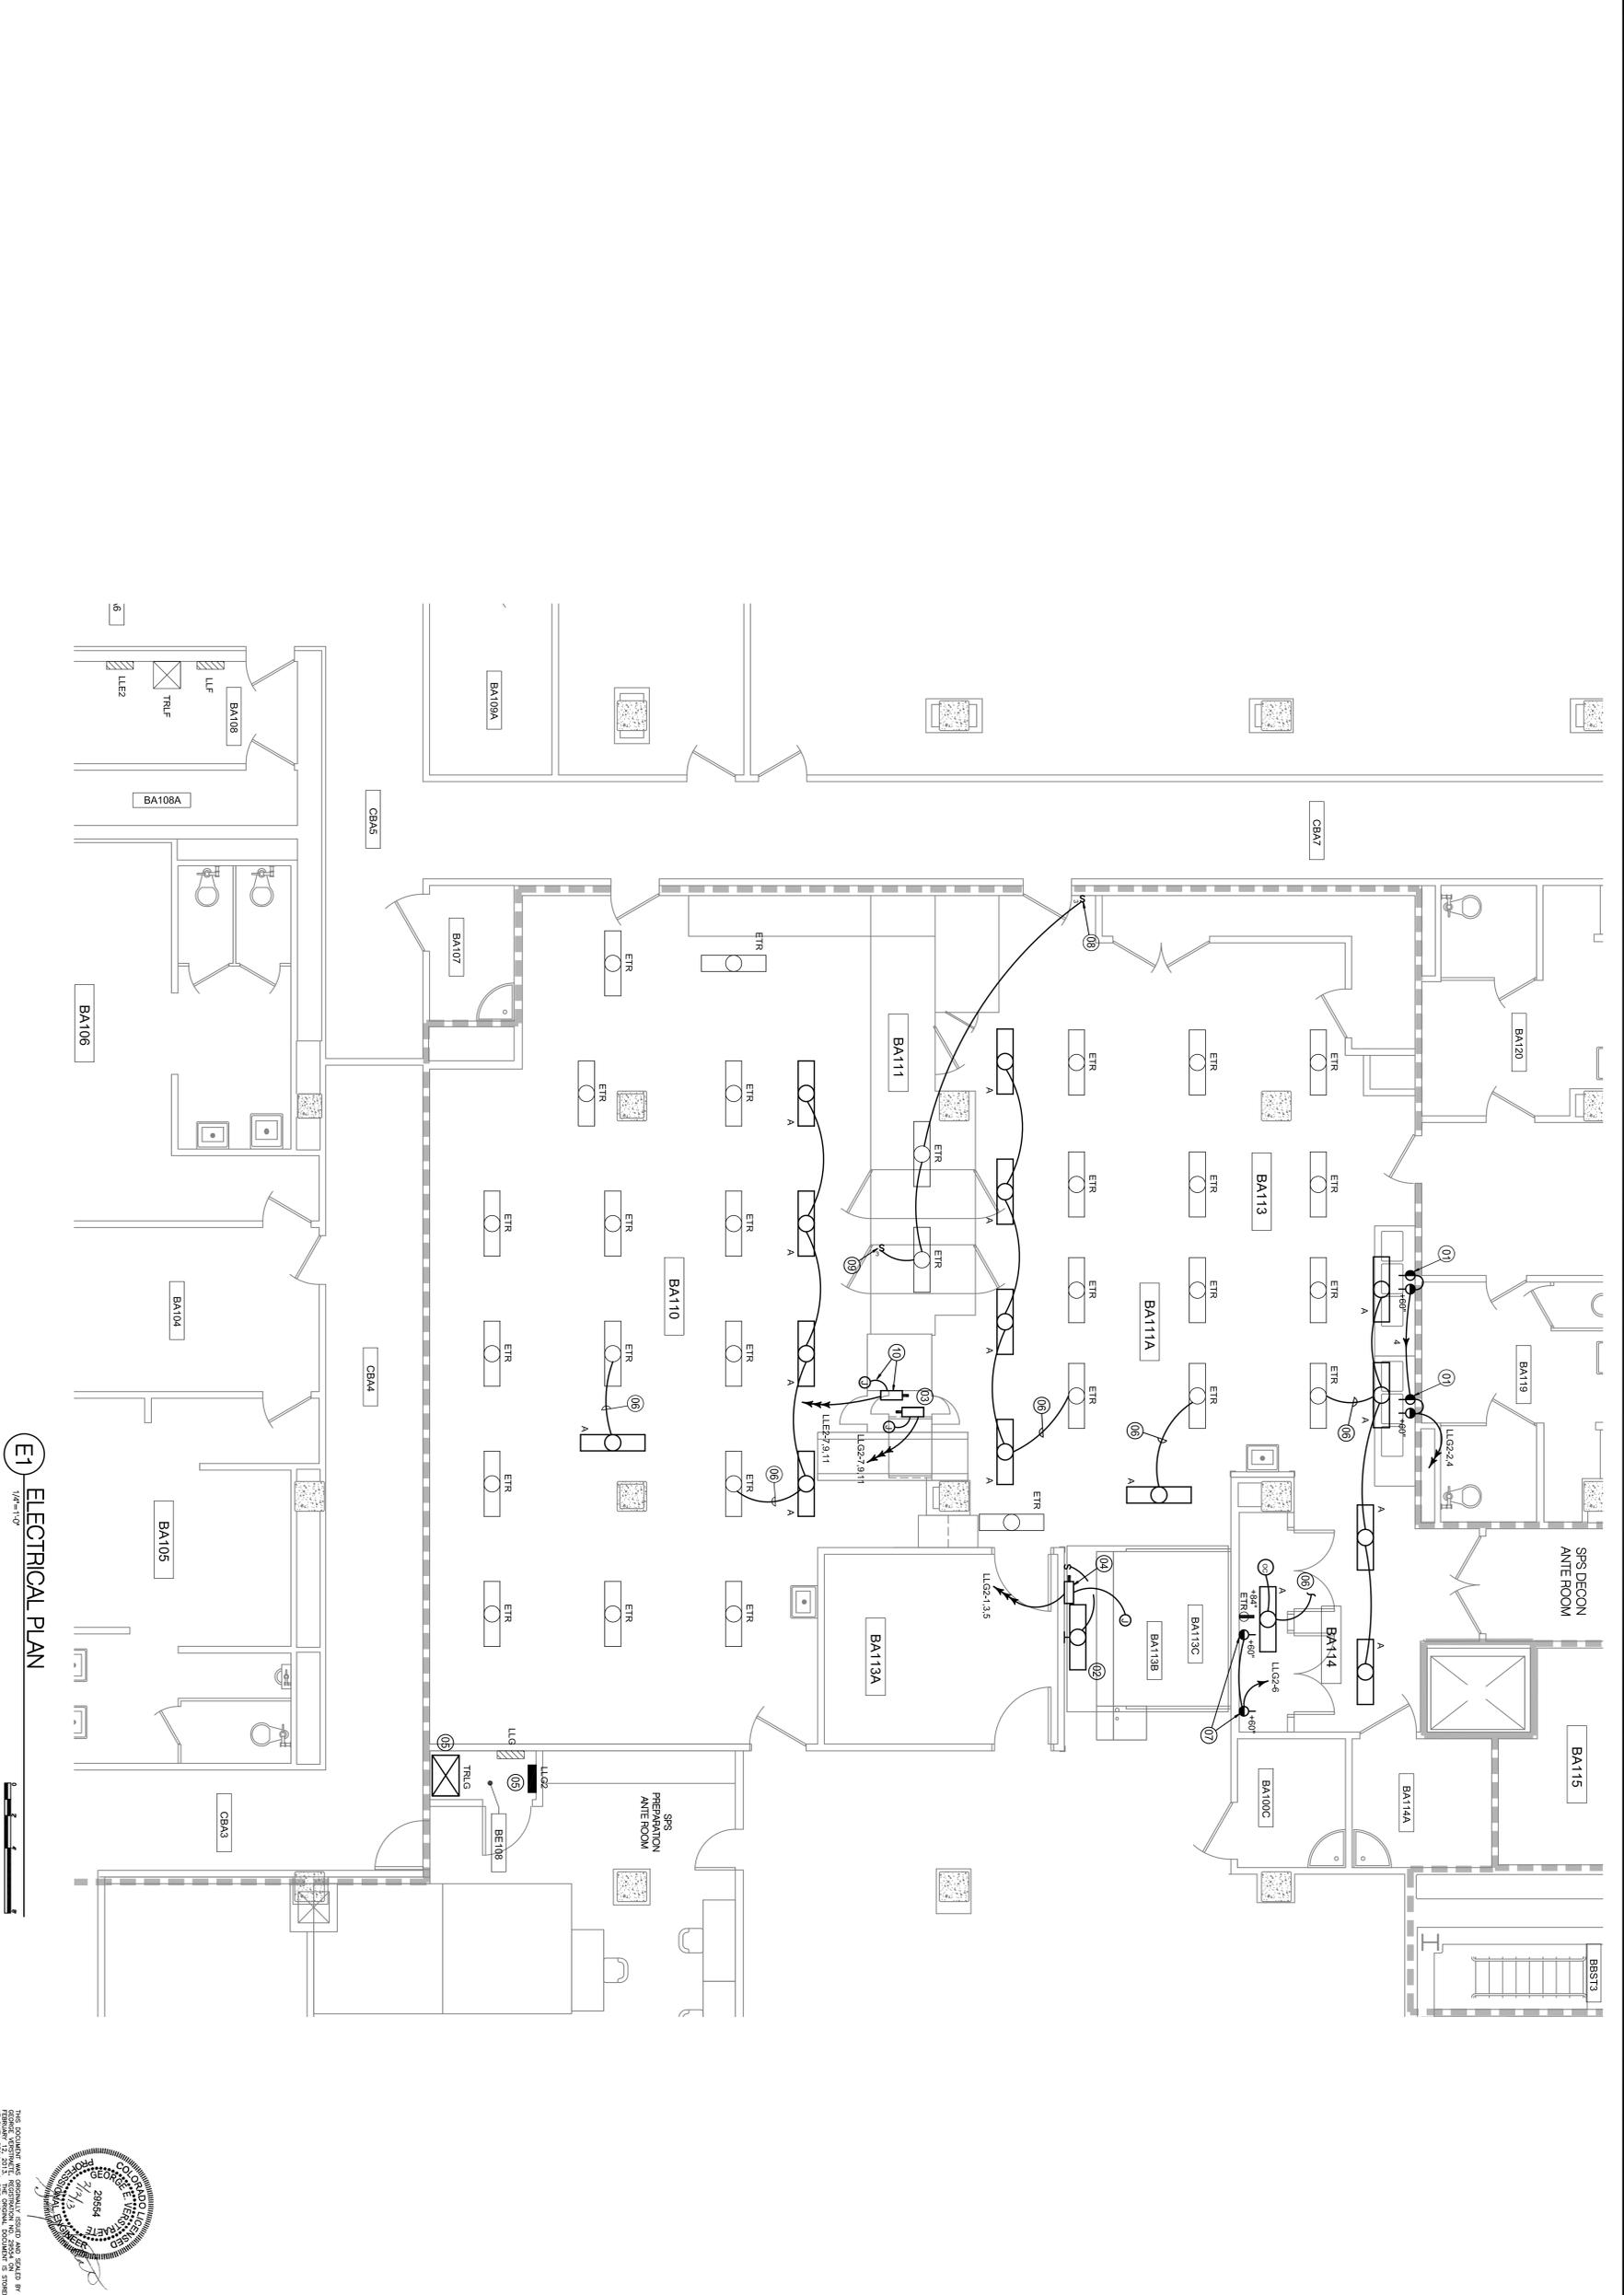
**Dwg. 17 of 19**

**Project Number**  
 554-12810

**Building Number**  
 BUILDING 1

**Drawing Number**  
 E201

**Office of Construction and Facilities Management**

**RENOVATION LEGEND**

—	NEW CONSTRUCTION
- - -	EXISTING TO REMAIN
⊕	CONNECT TO EXISTING AT THIS POINT
—	ONE HOUR FIRE WALL
- - -	TWO HOUR FIRE WALL
⋯	SMOKE ZONE

**GENERAL NOTES**

- LABEL ALL NEW WIRING DEVICES AND DISCONNECTS WITH ADHESIVE LABELS INDICATING SOURCE PANEL AND CIRCUIT STANDARD LABELS.
- LOCATE RECEPTILES FOR SINK TO CONVENIENTLY CONNECT THE CORD AND PLUG FROM THE SINK ADJUSTMENT MOTOR. MAKE RECEPTACLE TO CORD AND PLUG STEEL DEVICE COVERS. VERIFY EXACT LOCATION AND REQUIREMENTS WITH EQUIPMENT SUPPLIER PRIOR TO ROUGH-IN.
- REINSTALL LIGHT FIXTURE AND SWITCH FROM EXISTING CART WASHER ENCLOSURE. RECONNECT TO ORIGINAL CIRCUIT.
- NEW STERILIZER - 36.0 FLA. 208V, 3PH. PROVIDE 60A/3P HEAVY DUTY DISCONNECT SWITCH WITH 60A/3P FUSES. COORDINATE SUPPLIERS. HOMERUN IS 88, #10 G11TC.
- NEW CART WASHER - 25.5 FLA. 208V, 3PH. PROVIDE 40A/3P HEAVY DUTY DISCONNECT SWITCH WITH 40A/3P FUSES. COORDINATE SUPPLIERS. HOMERUN IS 88, #10 G11TC.
- PROVIDE NEW TRANSFORMER AND PANEL LLG2 RECONNECT PANEL LLG.
- CONNECT TO EXISTING 277V LIGHTING CIRCUIT SERVING AREA. COORDINATE LIGHT FIXTURE LOCATION WITH EXISTING CEILING ACCESS DOORS AND OTHER OBSTRUCTIONS. DO NOT COORDINATE WITH EXISTING CEILING OR ABOVE CEILING OBSTRUCTIONS. PROPOSE NEW LOCATIONS AND/OR ROTATIONS OF THE LIGHT FIXTURES TO THE DOWN FROM TO ROUGH IN.
- PROVIDE RECEPTACLE FOR CONNECTION TO VERIFY EXACT LOCATION AND REQUIREMENTS WITH EQUIPMENT SUPPLIER PRIOR TO ROUGH-IN.
- REPLACE EXISTING SPST LIGHT SWITCH WITH NEW 3-WAY SWITCH AND WIRING.
- PROVIDE NEW 3-WAY SWITCH. COORDINATE MOUNTING LOCATION IN EQUIPMENT ENCLOSURE IN FIELD WITH OWNER.
- REINSTALL EXISTING DISCONNECT TO EXISTING STERILIZER. RECONNECT TO EXISTING STERILIZER.

**KEY NOTES**

- LOCATE RECEPTILES FOR SINK TO CONVENIENTLY CONNECT THE CORD AND PLUG FROM THE SINK ADJUSTMENT MOTOR. MAKE RECEPTACLE TO CORD AND PLUG STEEL DEVICE COVERS. VERIFY EXACT LOCATION AND REQUIREMENTS WITH EQUIPMENT SUPPLIER PRIOR TO ROUGH-IN.
- REINSTALL LIGHT FIXTURE AND SWITCH FROM EXISTING CART WASHER ENCLOSURE. RECONNECT TO ORIGINAL CIRCUIT.
- NEW STERILIZER - 36.0 FLA. 208V, 3PH. PROVIDE 60A/3P HEAVY DUTY DISCONNECT SWITCH WITH 60A/3P FUSES. COORDINATE SUPPLIERS. HOMERUN IS 88, #10 G11TC.
- NEW CART WASHER - 25.5 FLA. 208V, 3PH. PROVIDE 40A/3P HEAVY DUTY DISCONNECT SWITCH WITH 40A/3P FUSES. COORDINATE SUPPLIERS. HOMERUN IS 88, #10 G11TC.
- PROVIDE NEW TRANSFORMER AND PANEL LLG2 RECONNECT PANEL LLG.
- CONNECT TO EXISTING 277V LIGHTING CIRCUIT SERVING AREA. COORDINATE LIGHT FIXTURE LOCATION WITH EXISTING CEILING ACCESS DOORS AND OTHER OBSTRUCTIONS. DO NOT COORDINATE WITH EXISTING CEILING OR ABOVE CEILING OBSTRUCTIONS. PROPOSE NEW LOCATIONS AND/OR ROTATIONS OF THE LIGHT FIXTURES TO THE DOWN FROM TO ROUGH IN.
- PROVIDE RECEPTACLE FOR CONNECTION TO VERIFY EXACT LOCATION AND REQUIREMENTS WITH EQUIPMENT SUPPLIER PRIOR TO ROUGH-IN.
- REPLACE EXISTING SPST LIGHT SWITCH WITH NEW 3-WAY SWITCH AND WIRING.
- PROVIDE NEW 3-WAY SWITCH. COORDINATE MOUNTING LOCATION IN EQUIPMENT ENCLOSURE IN FIELD WITH OWNER.
- REINSTALL EXISTING DISCONNECT TO EXISTING STERILIZER. RECONNECT TO EXISTING STERILIZER.